
4. Exploded View

Indoor Unit (152302A) (152302B) (131410) 35211B W50400 W6640 268711B

Note) * Please ensure GCSC since the replacement parts may be changed depending upon the buyer's request. Please check the correct parts in View RPL(Replacement Part List) on GCSC. (GCSC Website http://biz.Lgservice.com,)

Outdoor Unit: AS-W0964GG1(S09AM)

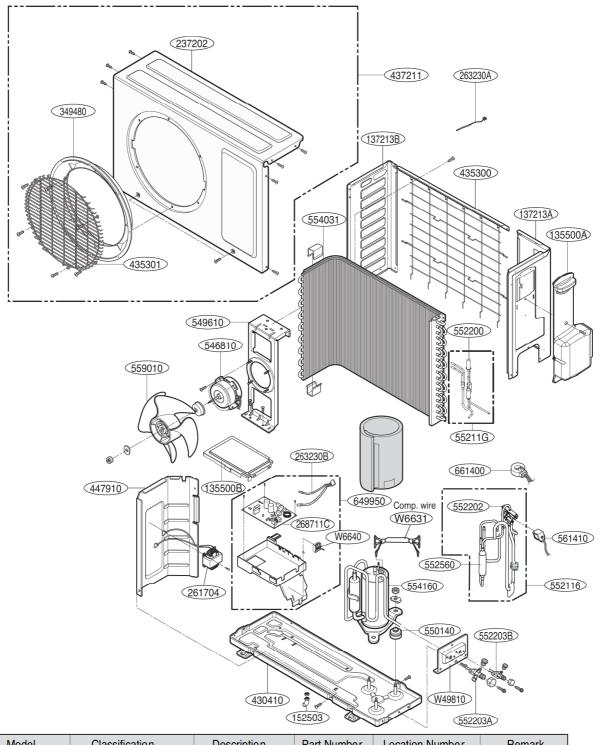


| Model | Classification | Description | Part Number | Location Number | Remark |
|-------------|----------------------|----------------|-------------|-----------------|--------|
| ASUW0964GG1 | Inverter Heat / Pump | Compressor | 5416A90029C | 554160 | - |
| (S09AM) | | Harness,Single | 6631A30099D | W6631 | |

Note) * Please ensure GCSC since the replacement parts may be changed depending upon the buyer's request.

Please check the correct parts in View RPL(Replacement Part List) on GCSC.

(GCSC Website http://biz.Lgservice.com,)

AS-W1264GG1(S12AM)

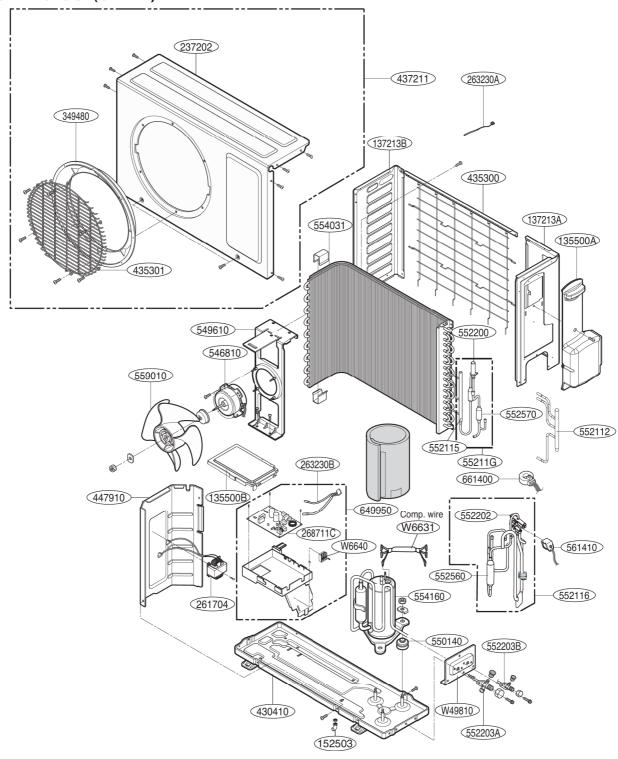

| Model | Classification | Description | Part Number | Location Number | Remark |
|-------------|----------------------|----------------|-------------|-----------------|--------|
| ASUW1264GG1 | Inverter Heat / Pump | Compressor | 5416A90029C | 554160 | - |
| (S12AM) | | Harness,Single | 6631A30099D | W6631 | |

Note) * Please ensure GCSC since the replacement parts may be changed depending upon the buyer's request. Please check the correct parts in View RPL(Replacement Part List) on GCSC. (GCSC Website http://biz.Lgservice.com,)