



typ modelu:
LL65XEU

Kod handlowy:
29910

Informacje Główne


Przewodnik Dokumentacji Technicznej

Możesz tutaj odnaleźć podstawowe informacje ułatwiające korzystanie z dokumentacji technicznej

1. Modele tej samej gamy posiadają wspólne rysunki, które przedstawiają najbogatszy zestaw części; generalnie wybrany model niekoniecznie posiadać będzie w spisie części wszystkie pozycje przedstawione na rysunku
 2. Niektóre części nie mogą być przedstawione bezpośrednio na rysunku (instrukcje użytkownika, zestawy montażowe itd.). Można je odnaleźć w liście części pod pozycją gdzie są zainstalowane lub pod pozycją 09
 3. W prawym górnym rogu każdego rysunku widnieje numer seryjny wskazujący początek produkcji danej gamy urządzeń. Niektóre modele mogą posiadać więcej niż jeden rysunek dla podanej kategorii, każdy inny dla różnych numerów seryjnych.
 4. Rysunki złożeniowe mogą wymagać dalszych uaktualnień po ich publikacji. Nowe części zostaną dodane do odpowiednich oznaczeń numerycznych rysunku. Oznaczenie kodowe modyfikacji rysunku zawarte jest w ostatnich 4 cyfrach numeru seryjnego przedstawionego w prawym górnym rogu rysunku.
 5. Lista części odnosząca się do danego rysunku zawiera spis części tylko dla wybranego modelu; dostępne są dodatkowe informacje dla każdej części.
- REF. Numer referencyjny do tabeli; SUBSTITUT: lista części które zastępują dany kod zachowując takie same charakterystyki funkcjonalne
- KOD HANDLOWY: lista wariantów modelu (pokazana w nazwie modelu) gdzie dana część jest zastosowana; UWAGA: kod informacji potrzebny do interwencji, prześledź zmiany aby poprawnie ustalić kod części
6. Niektóre notatki techniczne są ogólne dla danej sekcji, zatem nie mogą być związane tylko konkretną częścią. Aby poruszać się w dokumentacjach modelu sprawnie, pomocne jest czytanie notatek i monitorowanie uaktualnień dokumentacji.
 7. Okładka dokumentacji technicznej przedstawia model sprzętu oraz jego kod handlowy.

2210120

rysunki

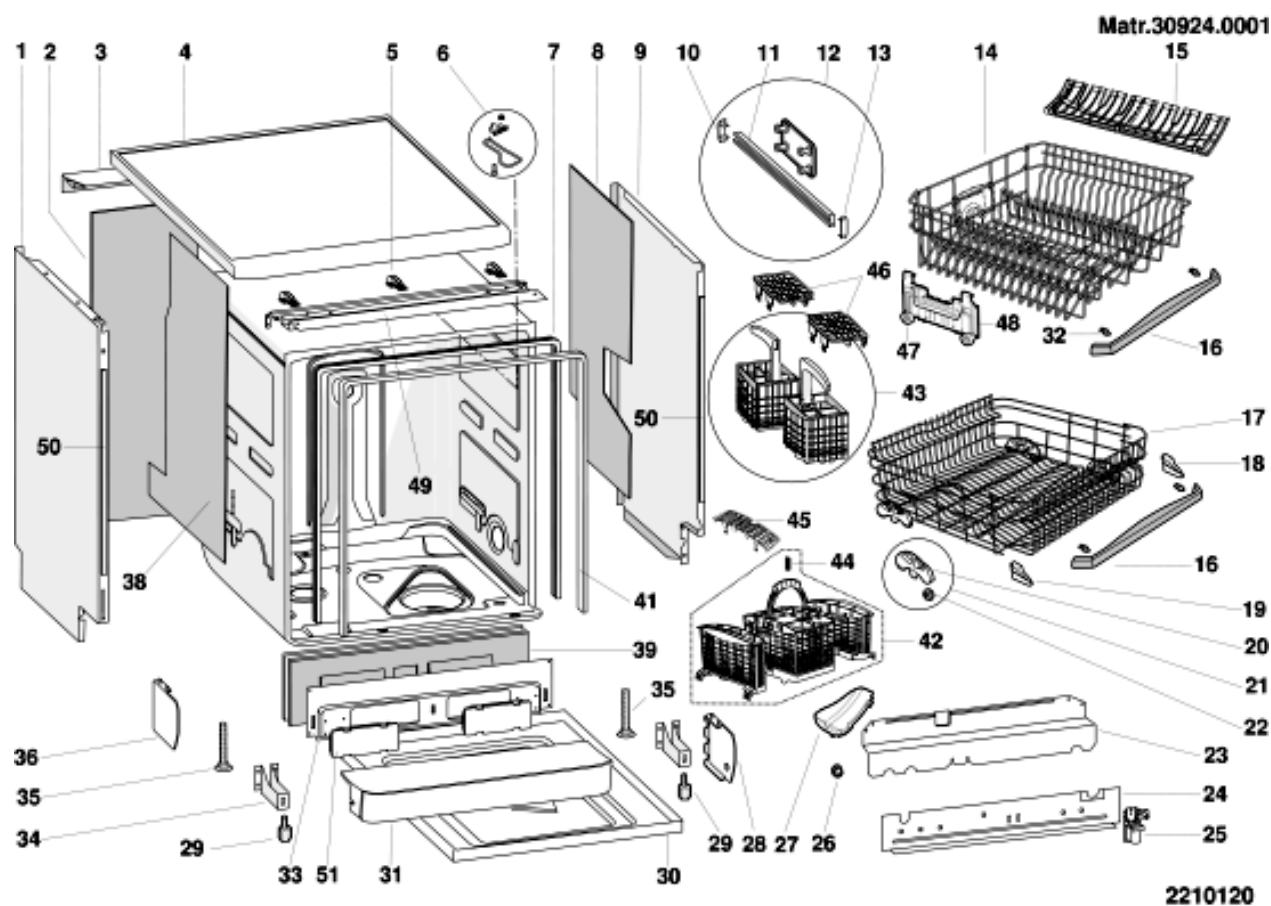

2210120

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
000	C00095931				instruction book it-gb-fr-de-nl-es-		
001	C00092831			1 x C00092837	side panel lh metal		
002	C00075715				plyta tylna falowana		
003	C00033591				wspornik tylny górny 'ls com'		
004	C00094877				górnica inox evo3		
005	C00057504				kołek mocujący półkę		
006	C00085024				kołek mocujący równoważ. w		
007	C00116110			1 x C00141317	uszczelnienie zbiornika mm1608	n1045127	
007	C00141317				uszczelnienie zbiornika mm1638	n1045127	
009	C00092832			1 x C00092837	side panel rh metal		
010	C00094117				ogranicznik tylny prowadnicy		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00080960				self blocking nut m5		
012	C00094112				runner assembly		
013	C00094118				ogranicznik przedni prowadn.		
014	C00094222			1 x C00115002	upper basket assembly adjustable	n1045069 n1045093	37299100000
014	C00115002		50607...	1 x C00114486	upper basket assembly adjustable	n1045093 n1045110	37299100000
014	C00118141	50608...			zespół kosz górny regulowany		37299100100
015	C00094140				klapka uchylna koszyczka	n1045093	
015	C00114799				light blue flap upper basket evo3	n1045093	
016	C00094186				manche basket light blu 651		
017	C00094135			1 x C00275698	zespół kosz dolny evo3	n1045069	
018	C00094181				cap lower basket right evo3		
019	C00094187				cap lower basket left evo3		
020	C00086476				korpus kółko kosza dolnego		
021	C00086474				zespół kółka kosza dolnego		
022	C00086475				kółko koszyka dol.		
023	C00091600				wspornik pośredn. tylny		
024	C00091598				lower rear support reflex		
025	C00076659			1 x C00143383	filtr tłumiący		
026	C00054830				drain hose fastener		
027	C00088301				wanienka zbiorcza rury		
028	C00094874			1 x C00096844	base moulding cover plate right		


2210120

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
029	C00056414			1 x C00104611	adjustable foot - all plastic	n1045080	
029	C00109991				adjustable foot	n1045080	
030	C00092554			1 x C00118842	miseczka dno zbiornika 60cm		
031	C00094876				cokół wypukły inox evo3		
033	C00091599			1 x C00119016	front support lower 60cm		
034	C00056010				wspornik nóżki typ x 'lvs2000'		
035	C00092555				nóżka 155mm lvs evizzate	N1045072	
036	C00094875				base moulding cover plate left		
039	C00076390				front panel soundproofing l.i.60cm		
041	C00054932				rama podtrz. uszczelka zbiornika	n1045047	
042	C00094127			1 x C00094137	single basket evo3		
				1 x C00119532			
042	C00094137			1 x C00119532	zespół kosz na sztućce ariston		
044	C00086484				spring for		
045	C00087980				kratka kosza na sztućce new		
047	C00094191			1 x C00109840	kółko kosza górnego evo3		
048	C00094223			1 x C00109417	set door handle evo3		
049	C00079013				listwa poprz. przednia górna		
050	C00082457				sponge		
051	C00054833				top for front support		
099	C00094138				lower basket buffer evo3		

2210220

rysunki

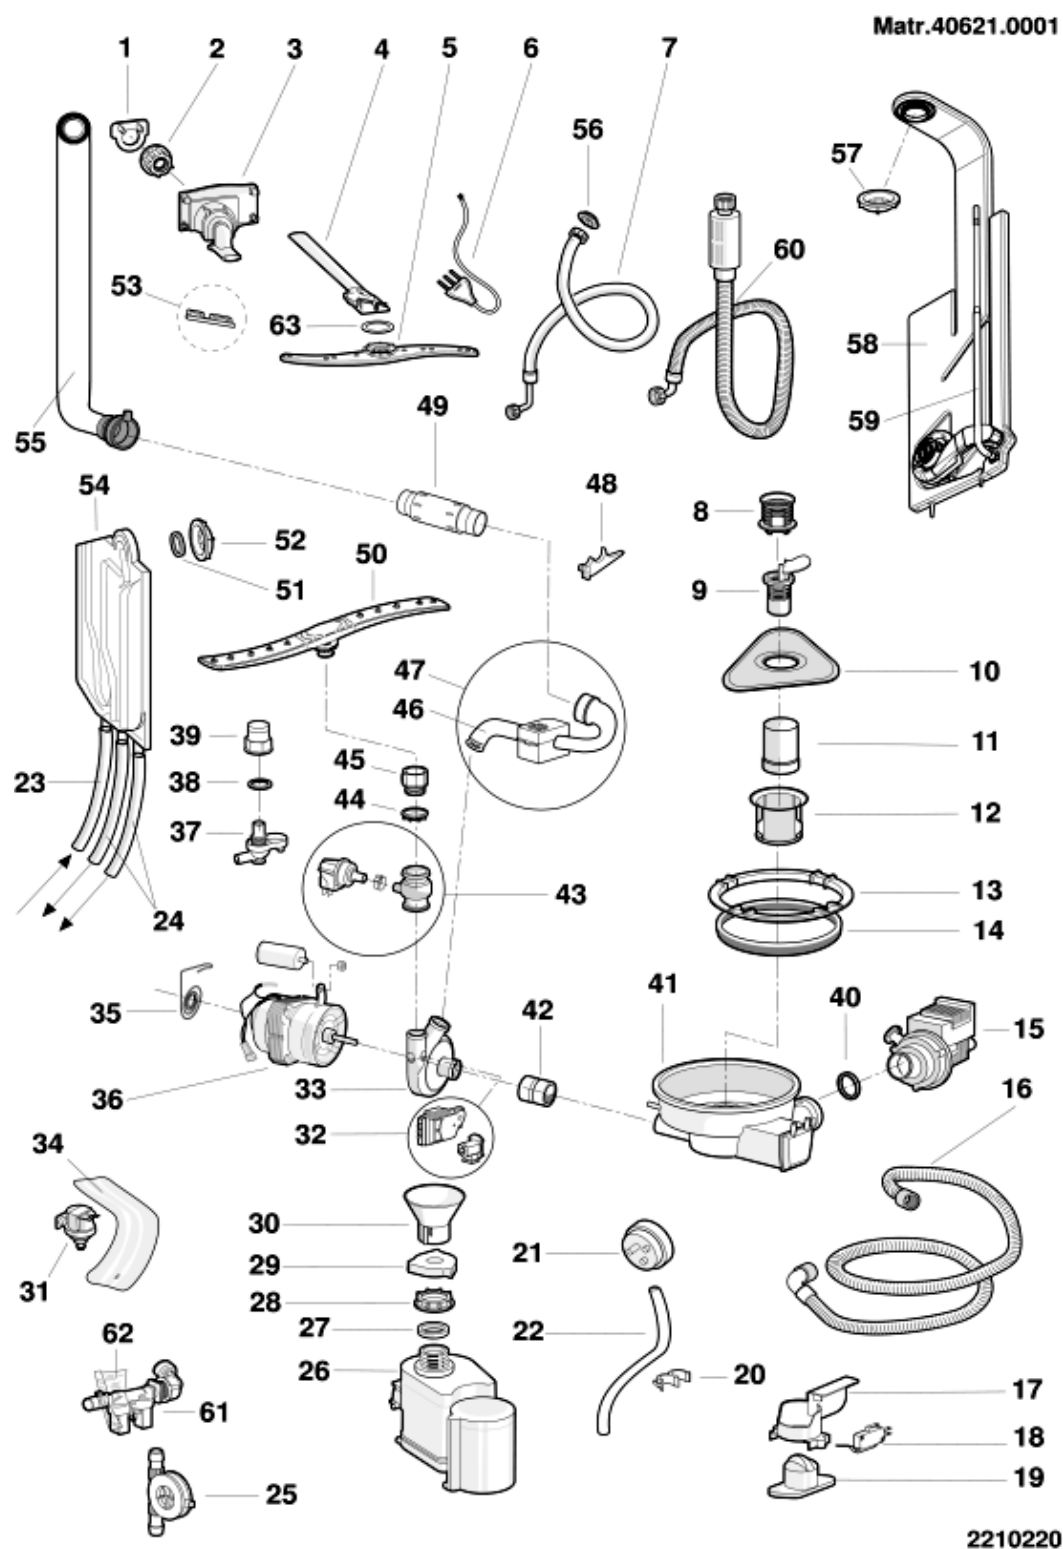

2210220

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
001	C00054925				osłona prowadnicy kosza 'lvs		
002	C00144315				pierśc.mocuj.przew.zewnęt.wirn.s		
003	C00094134			1 x C00110526 1 x C00110527	zespół rozdzielacz zasilania evo3	n1045084	
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526 1 x C00110527	przewód wewnętrzny 'lvs 2000'	n1045084	
004	C00110527				przewód wewnętrzny evo3		
005	C00075746				zespół skraplacz górny wygięty		
006	C00143371			1 x C00280937	kabel zasilający z wtyczką schuko		
008	C00094158			1 x C00142344	kratka filtruj. centraln. evo3	n1045083	
009	C00054863			1 x C00142344	filtr centraln. 'lvs2000'		
009	C00094156			1 x C00142344	filtr centraln. evo3	n1045083	
010	C00145075				filtr wymowaln. inox lvs2000		
011	C00081164			1 x C00142344	filtr z twor. sztucznego cylindr.		
011	C00094164			1 x C00142344	filtr z twor. sztucznego cylindr.	n1045083	
012	C00061929				mikrofiltr z poliestru		
013	C00054854				pierścień zamocowania studzienki		
014	C00054828				uszczelnienie studzienki 'lvs 2000'		
015	C00143739				pompa spust. 230v 50hz evo3 rohs		
016	C00054869				rura spustowa 'lvs2000'		
017	C00081162				wspornik pływaka do urządz.		
018	C00143107				microwyłącznik acquastop rohs		
019	C00058843				pływak do urz. przeciwprzelew.		
021	C00143740				presostat 90 71 evo3 rohs		
022	C00094154				pipe pressostat lvs evo3		
023	C00094267				tube water inlet air-break/turbine	n1045085	
023	C00110612			1 x C00111855 1 x C00115348	tube water inlet electrovalve/air-	n1045085	
024	C00054868				rura odprowadz. /coppa 1.480mm		
025	C00094172				turbina evo3	n1045085	
026	C00094171				odkamieniacz regulow. evo3		
027	C00103610				uszczelnienie pierścienia sale		
028	C00144235				pierścień sale 'new aristella' rohs		
029	C00041088				zatyka solis 'new aristella'		

2210220

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
030	C00005819				ciagn. sól		
032	C00054985				elektrozawór pół ładunku	n1045070	
032	C00077172			1 x C00141156	siln. rozruch. zmyw. zmienn.	n1045070	
033	C00054979				osłona spir. złożona 'lvs 2000'	n1045070	
033	C00088889				osłona spir. złożona	n1045070	
035	C00076628				sprężyna zawieszenia silnika		
036	C00077140				pompa elektr. zespół220v75w	n1045070	
036	C00088896			1 x C00115896	pompa elektr. płukanie w45 v220	n1045070	
037	C00094159		60903...		overflow connector evo3		
037	C00196353	60904...			overflow connector evo3		
038	C00075695				uszczelnienie złącza przepł.		
039	C00143580		60903...		korpus overflow evo3 rohs		
039	C00196352	60904...		1 x C00094159	korpus overflow evo3 rohs		
				1 x C00143580			
040	C00054917				uszczelnienie or (23,81x2,62)		
041	C00094143			1 x C00141158	zespół studzienka osłona kompl.		
042	C00079016				tuleja zest. siln		
043	C00094157			1 x C00142435	zespół czujnik wysokiego		
				1 x C00144125			
044	C00144189				cap corner for supp.wash.blade		
045	C00144196				support - lower wash arm bush		
046	C00091568				rura odpowietrzająca zestawu		
047	C00143577				zespół zestaw przec.zmętn.do rohs	n1045071	
048	C00078394				wspornik tulei opornika		
049	C00057684				opornik myjki chow. w2000 60		
050	C00094182				wirnik doln. tworz. szt. 60cm evo3		
051	C00084600				uszczelnienie dyszy '(lvs/89)'		
052	C00054927			1 x C00144335	ring-nut for air-flow body		
053	C00056342				sworzeń montaż. przewodu	n1045084	
054	C00094174				water inlet air break evo3	n1045085	
054	C00110610			1 x C00115360	air break + turbine evo3	n1045085	
						n1045127	
054	C00141308			1 x C00141655	air break + turbina evo3	n1045127	
055	C00094152				external pipe (hidden heating		
060	C00083761				rura doprowadzająca z acquastop		


2210220

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
061	C00087337				uszczelnienie klej. do		
061	C00094168				elektrozawór podwójny 4l/1 evo3	n1045085	
061	C00143737				elektrozawór ładowanie	n1045085	
062	C00094160				zabezpieczenie elektrozaworu		
099	C00033026				opakowanie smar amblig ta 100		
099	C00073917				zacisk tulei gumow. cima na-929-		
099	C00077010				zacisk osłon opornika chowan.		
099	C00084479				zacisk rur hydraulicznych dwóch		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2210310

rysunki

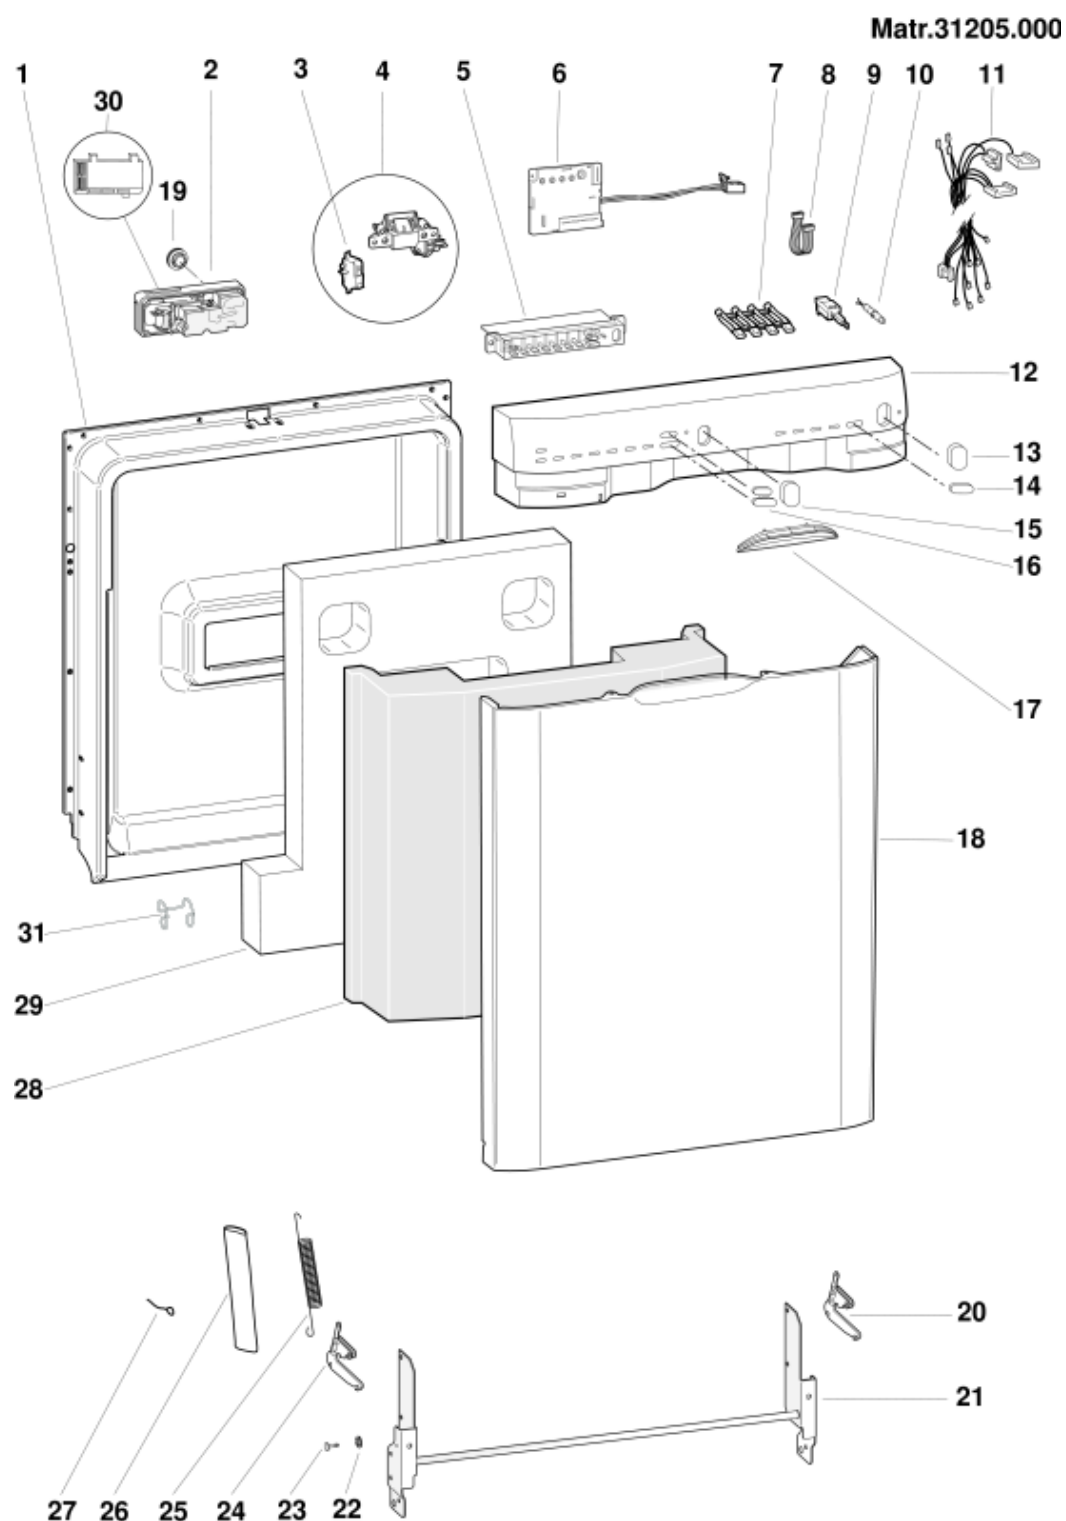

2210310

2210310

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
001	C00091543				uszczelnienie doln. zbiornika		
001	C00094695		50607...		zespół drzwi wewn. evo3	n1045110 n4509a00	37299100000
001	C00108981	50608...			inner door panel stainless l.i.		37299100100
002	C00143377				electrodisp.(lamp rinseaid-no	n1045071	
002	C00143801				electrodisp.(no lamp rinseaid-	n1045071	
003	C00085358				microwyłącznik zestawu		
004	C00094128			1 x C00195887	zestaw zamykający drzwi evo3		
005	C00143537				zespół suport + karta led evo3 rohs		
006	C00094686				timer bit100.1 'd' + n1045048	n1045070	
006	C00097431			1 x C00097481	timer bit100.1 'p2' + n1045048	n1045070	
				1 x C00143207		n1045071	
006	C00108957				obsada timera bit 100		
006	C00143207				timer bit100.1 'e2' rohs +	n1045071	
007	C00094123				szkiełko oświetl. evo3		
008	C00094126				8-way wire evo3		
009	C00058465				wyłącznik (double pole) on-off		
010	C00057635				lampka kontrolna czerw. otwory		
011	C00095933				wiring harness assembly	n1045070	
011	C00098829				wiring harness assembly	n1045070 n1045071	
011	C00098981			1 x C00112906	wiring harness assembly	n1045071	
012	C00098099				dashboard vesmalit ll65xeu		
013	C00094975				push button on-off inox evo3		
014	C00094121				push-button delay timer evo3		
015	C00094982				push-button start inox evo3		
016	C00094122				program select button evo3		
017	C00094241				soft grip handle		
018	C00094872				drzwi zewn. inox wypukł. evo3		
019	C00051755				zestaw zatycz. elektrod.błysz.		
020	C00065127			1 x C00054815	hinge item, right		
021	C00096996				zespół zawias 'lvs evo3'		
022	C00058776				pierścień sworznia zawiasu		
023	C00048504				sworzeń zawiasu 'ls615st'		
024	C00065128			1 x C00054817	hinge item, left		

2210310

Lista części

Ref.	kod	Od S/N	Do S/N	Zamiennik	opis	Notatka	kod
025	C00075689				sprężyna drzwiczek		
027	C00075693				widelki do zaczepu sprężyny		
028	C00094147		50607...		door spacer assy	n1045110	37299100000
028	C00109857	50608...			door spacer assy		37299100100
029	C00094184		50607...	1 x C00097501	front panel soundproofing evo3	n1045110	37299100000
029	C00109858	50608...			front panel soundproofing evo3		37299100100
030	C00098134				drzwiczki elektrodystyb. 'evo3'	n1045069	
031	C00140679				seal spring	n1045127	
099	C00076108				śruba canoe klip		
099	C00082166				rivet		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00111286				trasparent door lvs evo3 60cm		

Notatki

N1045072: Introduction of fixed rear foot H=31mm on free-standing models.


From serial no. 40218.0001, free-standing dishwashers affected by this modification have been equipped with new fixed rear feet (H=31mm).

The new foot replaces the adjustable one (H=155mm) Service code 092555; on the EVO3 range with TurboDry the new foot replaces the adjustable foot (H=95mm) Service code 094605.

The Spare Part Warehouse will continue to manage only 155mm and 95mm adjustable feet as they are interchangeable with the fixed 31mm foot.

The three feet are shown in illustration N1045072FIG1.

N1045072FIG1

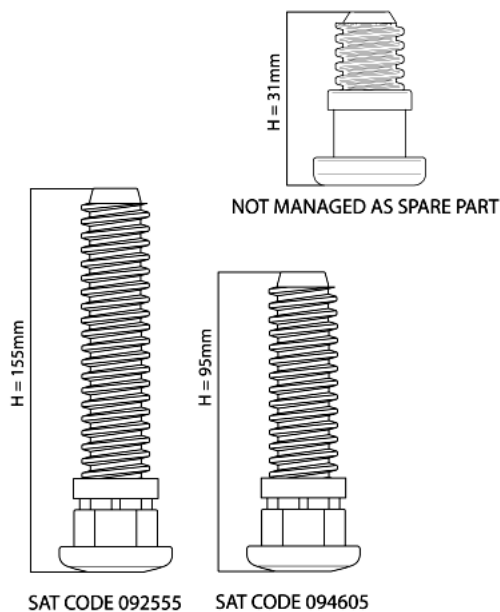

n1045048: PROCEDURA INICJALIZACJI KARTY BIT 100

Zmywarka wolnostojąca

- 1- Włączyć urządzenie przy zamkniętych drzwiczkach
- 2- Odczekać na uruchomienie się cyklu próbnego (2 diody led włączone, lub komunikat "ROD" na zmywarkach z wyświetlaczem).
- 3- Odczekać 10 sekund (urządzenie rozpoczyna pobór wody ...)
Uwaga! Jeśli cykl się nie rozpoczyna, prawdopodobnie karta była już zainicjowana. Przejść do punktu 5
- 4- Resetować cykl próby ustawiając pokrętko programatora na pozycji Reset lub wciskając przycisk Start /Reset na 5 sekund. (Odczekać 3 sygnały dźwiękowe brzęczyka lub, w zmywarce bez brzęczyka, do wyłączenia kontrolki programów)
- 5- Aby sprawdzić, czy w/w czynności się powiodły, wybrać program i sprawdzić, czy się uruchamia. (Następnie restartować urządzenie)
- 6- Urządzenie jest gotowe dla klienta.

Zmywarka całkowicie do zabudowy

- 1- Włączyć urządzenie i zamknąć drzwiczki.
- 2- Odczekać na uruchomienie cyklu próbnego
- 3- Odczekać 10 sekund (urządzenie rozpoczyna pobór wody ...)
Uwaga! Jeśli cykl się nie rozpoczyna, prawdopodobnie karta była już zainicjowana. Przejść do punktu 5
- 4- Otworzyć drzwiczki (2 diody są włączone) i restartować cykl wciskając przycisk programów, aż do usłyszenia 3 sygnałów dźwiękowych (w zmywarkach bez brzęczyka, aż do wyłączenia się kontrolki programów)
- 5- Aby sprawdzić, czy w/w czynności się powiodły, wcisnąć przycisk wyboru programów i sprawdzić, czy po kolei zapalają się kontrolki wybranych programów.
- 6- Urządzenie jest gotowe dla klienta.

n1045069: Modification of racks and dispenser lid on EVO3 dishwashers

To obtain better dissolving of the detergent during the wash cycle, the following modifications have been made to EVO3 dishwashers:

- new dispenser lid, replacement code 098134 (see figure N1045069FIG4) created;
- upper racks modified with lid catch angle changed from 9° to 16° (see figure N1045069FIG5);
- MultiSystem lower racks modified with insertion of a spacer wire at the electric dispenser (see figure N1045069FIG6).


The upper and lower racks have the same spare part codes as the premodification items; Replacements Warehouse stocks have been replaced.

Lid installation instructions:


- 1) prise the lid out of the dispenser seat using a small screwdriver at point A (figure N1045069FIG1);
- 2) replace the lid, checking that release spring B (figure N1045069FIG2) is in place; before fitting the new lid load the spring from position 1 to position 2 (figure N1045069FIG2);
- 3) fit the lid in its special seat and check for correct operation (figure N1045069FIG3).

Lid closing may be harder for the first few cycles after replacement, due to settling of the material.

N1045069FIG1

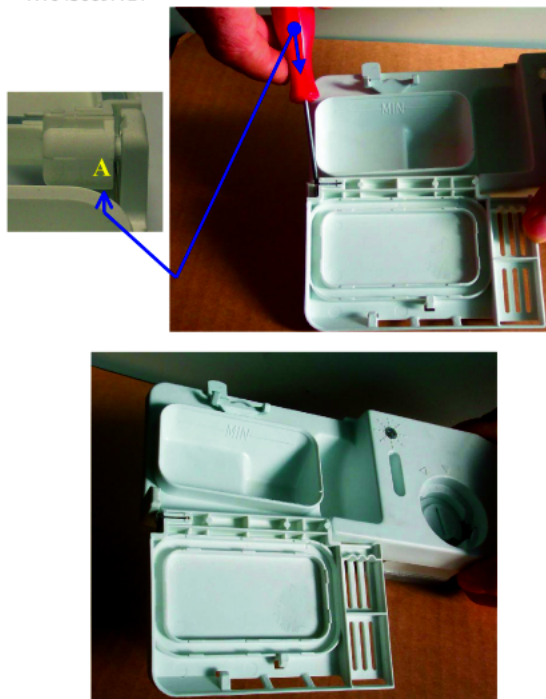


N1045069FIG2

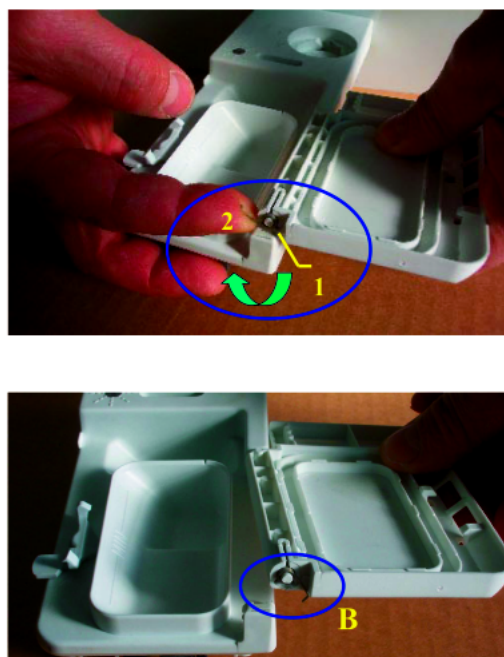


N1045069FIG3




N1045069FIG4

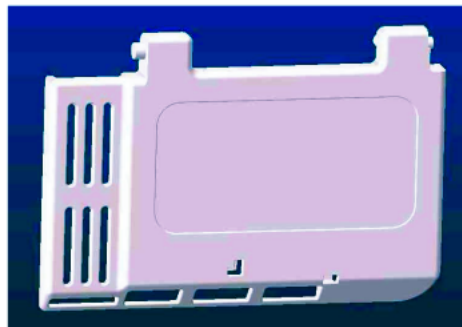

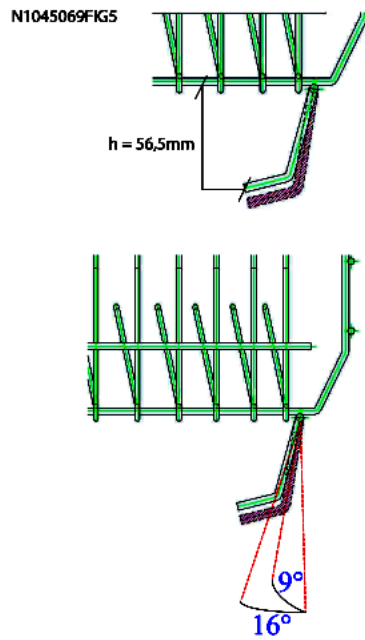

N1045069FIG6

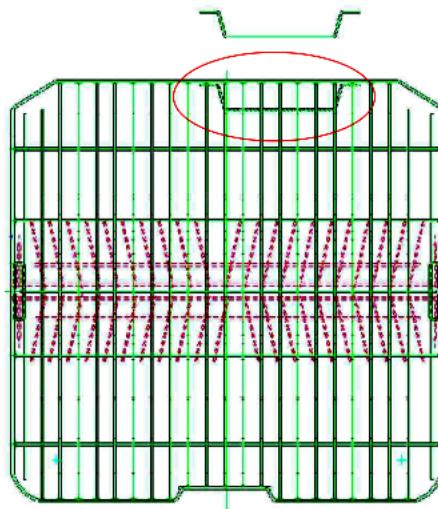

n1045070: Introduction of 1/2 load control with BIT 100 timer by means of solenoid valve.

EVO3 dishwasher models affected by this modification have been equipped with the new BIT 100 timer, in place of the alternating wash motor, that controls the 1/2 load system by means of a solenoid valve located on the volute of the electric pump.

Modified items:

- electric pump code 088896(W45V220P20) replaced with 077140(W75V220P24);
- electric pump code 088888(W45V240P20) replaced with 080512(W75V240P24);
- volute code 088889 replaced with 054979;

- BIT 100 timer code 094686 replaced with 097431;
- alternating wash motor code 077172 replaced with half load solenoid valve code 054985.

Given below are the models affected, with modification introduction serial no. and relevant new and premodification wiring/diagrams:

LL63TK Commercial Code 28471 Serial no. 31009.0001;
 Wiring: new 098825 premodification 094619;
 Wiring diagram: new 16001701900 premodification 16001645500.

LL63FR Commercial Code 28460 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401.

LL65TK Commercial code 28472 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401.

DWF50P Commercial Code 29790 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401

DWF50N Commercial Code 29791 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401.

DWF50S Commercial Code 29792 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401.

DWM55A Commercial Code 29793 Serial no. 31017.0001;
 Wiring: new 098826 premodification 094226;
 Wiring diagram: new 16001695400 premodification 16001639401

LL65IT Commercial Code 28903 Serial no. 31030.0001;
 Wiring: new 098827 premodification 094130;
 Wiring diagram: new 16001696000 premodification 16001626801.

LL64EU Commercial Code 29545 Serial no. 31030.0001;
 Wiring: new 098827 premodification 094130;
 Wiring diagram: new 16001696000 premodification 16001626801.

LL64XEU Commercial Code 29546 Serial no. 31030.0001 ;
 Wiring: new 098827 premodification 094130 ;
 Wiring diagram: new 16001696000 premodification 16001626801.

LL63EU Commercial Code 29909 Serial no. 31114.0001 ;
 Wiring: new 098789 premodification 097853 ;
 Wiring diagram: new 16001700900 premodification 16001698100.

LL63XEU Commercial Code 30174 Serial no. 31114.0001 ;
 Wiring: new 098789 premodification 097853 ;
 Wiring diagram: new 16001700900 premodification 16001698100.

LL65FR Commercial Code 28462 Serial no. 31013.0001 ;
 Wiring: new 098828 premodification 094604;
 Wiring diagram: new 16001695800 premodification 16001639601.

LL65XFR Commercial code 29284 Serial no. 31013.0001 ;
Wiring: new 098828 premodification 094604;
Wiring diagram: new 16001695800 premodification 16001639601.

LL65EU Commercial Code 29547 Serial no. 31027.0001 ;
Wiring: new 098829 premodification 095933 ;
Wiring diagram: new 16001695900 premodification 16001657100.

LL65XEU Commercial Code 29910 Serial no. 31027.0001 ;
Wiring: new 098829 premodification 095933 ;
Wiring diagram: new 16001695900 premodification 16001657100

LL64AG Commercial Code 29908 Serial no. 40101.0001;
Wiring: new 098830 premodification 098096;
Wiring diagram: new 16001695700 premodification 16001674100.

n1045071: Elimination of turbidity sensor code 091523 on EVO3 Dishwashers.

From serial no. 40107.0001, the turbidity sensor spare part code 091523(Rohs 143577) has been eliminated from EVO3 dishwashers affected by this note.

This modification also concerns the timer BIT100 code 097481 (rohs 143207) that replaces 097431, the reed electric dispenser code 097874(Rohs 143801) in place of 094133(Rohs 143377), and new wiring/wiring diagrams.

Given below are the models affected, with relevant new and old wiring/wiring diagrams:

LL62XFR (commercial code 30615)
LL62FR (commercial code 30614)
LL63FR (commercial code 28460)
LL65TK (commercial code 28472)
DWF50P (commercial code 29790)
DWM55A (commercial code 29793)
DWF50S (commercial code 29792)
DWF50N (commercial code 29791)
Wiring: new 098980 - premodification 098826
Wiring diagram: new 16001741300 - premodification 16001695400

LL65XEU (commercial code 29910)
LL65EU (commercial code 29547)
Wiring: new 098981 - premodification 098829
Wiring diagram: new 16001741100 - premodification 16001695900

LL65XFR (commercial code 29284)
LL65FR (commercial code 28462)
Wiring: new 098982 - premodification 098828
Wiring diagram: new 16001742100 - premodification 16001695800

n1045075: Unification of Timer BIT 100 Service codes 097431 and 095281 with 097481.

BIT 100 "P2" TIMER (210097637.XX) Service code 097431 has been replaced with BIT 100 "E2" TIMER (210097877.02) Service code 097481.

BIT 100 "D" TIMER (210093806.XX) Service code 095281 has been replaced with BIT 100 "E2" TIMER (210097877.02) Service code 097481.


Replacement of Service codes 097431 and 095281 with 097481 is only possible with BIT 100 "E2" TIMER card code 210097877.02.

The card code is printed on an adhesive label located on the box or on the card itself (illustration N1045075FIG1).

Possible 210097877.XX card spares with modification index below 02 cannot be used for replacing, but can be used on the relevant INDESIT models (giving the BIT 100 "E2" TIMER Service code 097481 in the spare part list) until stocks last.

Stocks of Service code 097481 in the Spare Part Warehouse have been replaced with card 210097877.02.

N1045075FIG1

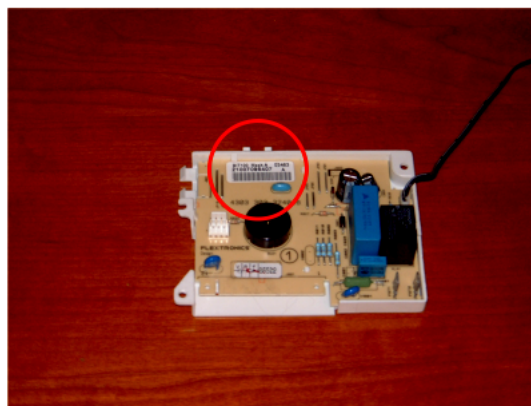


n1045080: Modification of front feet on free-standing DW.

From serial no. 40413.0001, free-standing dishwashers affected by this modification have been equipped with new front feet

Service code 109991 in place of 056414.
The new foot is shown in fig. N1045080FIG1.

N1045080FIG1

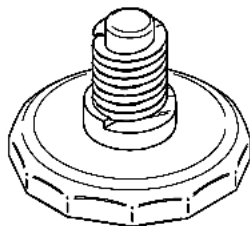

SAT CODE 109991

n1045082: Timer Bit 100 programmes for Evo3 60cm dishwashers

Table N1045082FIG1 shows information relevant to the programmes of the following Timer Bit 100 for Evo 3 60 cm dishwashers:

Timer BIT 100 - E1 - Service code 097890 (rohs 143206);
Timer BIT 100 - E2 - Service code 097481 (rohs 143207);
Timer BIT 100 - E3 - Service code 099892 (rohs 143208);
Timer BIT 100 - S1 - Service code 109875 (rohs 143211).

PROGRAMMES:

- 1) Energico or Super Wash or Intensive
- 2) Normal or Daily
- 3) Eco (Ciclo per Istituti)
- 4) Rapido
- 5) Ammollo
- 6) Cristalli
- 7) Special Guest
- 8) Just you
- 9) Duo-Wash o Crystal and Pot

PROGRAMME PHASES:

- A) Pre-wash
- B) Pre-wash
- C) Wash
- D) Rinse
- E) Rinse
- F) Rinse
- G) Drying

PROGRAMME MODIFICATIONS ARE INDICATED IN RED.

TIMER BIT 100 - EVO 3											
PROGRAMS	PROGRAM PHASES									Time	Effective Time
	A	B	C	D	E	F	G	L	Kwh		
1	X	40°C	65°C	cold	cold	65°C	✓	120'	125'	1,4	23,0
2	X	X (ex:cold)	55°C	cold	X	70°C	✓	72'	85'	1,25	16,0
3	cold	cold	50°C	X	X	65°C	✓	130'	138'	1,05	18,0
4	X	X	47°C (ex:40°C)	62°C	X	X	extra dry	24'	38'	0,7	10,0
5	cold	X	X	X	X	X	X	12'	12'	0,01	4,0
6	X	X	52°C (ex:55°C)	45°C	X	65°C	✓	98'	98'	1,16	16,0
7	X	X	X	X	X	65°C	✓	36'	38'	0,8	6,0
8	X	X	50°C	67°C	X	X	✓	40'	40'	0,9	10,0
9	cold	X	52°C (ex:55°C)	45°C	X	65°C	✓	108'	110'	1,18	18,0

n1045083: Modification of filters on EVO3 60 cm dishwashers

All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clogging problem.

Introduction of:

Cylindrical plastic filter code 081164

Central filter code 054863


Elimination of:

Cylindrical plastic filter code 094164

Central filter code 094156

Central filter grid code 094158

The modification has been introduced progressively, starting from serial no. 40516.0001.

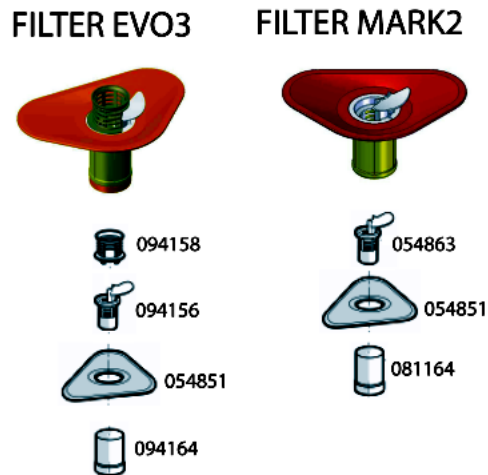

n1045084: Elimination of duct fixing pin code 056342

Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:

Internal duct 110527

Feeder-distribution assembly 110526

Eliminated items:

Internal duct 054926

Feeder-distribution assembly 094134 (EX 054871)

Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.

Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:

new 110610;

premodification 094174;

the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:

new:

1-WAY code 110611;

2-WAY code 084558(Rohs 143737);

premodification:

1-WAY code 094227;

2-WAY code 094168;

the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:

new solenoid valve hose/air-break code 110612;

premodification turbine hose/air-break code 094267;

premodification solenoid valve hose/air-break code 094267;

the new hose has a smaller internal diameter.

WIRING:

the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the premodification one.

Affected models with related modification introduction serial numbers:

BCI 450 - 30386 s/n 41001.0001;

BFI 620 - 30708 s/n 41001.0001;

BFI 680 - 30715 s/n 40902.0001;

BFV 620 B - 30718 s/n 41001.0001;

BFV 620 K - 30717 s/n 41001.0001;

BFV 620 W - 30719 s/n 41001.0001;

BFV 620 X - 30720 s/n 41001.0001;

DI 6 - 29930 s/n 41001.0001;

DI 620 A - 29932 s/n 40830.0001;

DI 620 - 29931 s/n 41001.0001.

DI 620 UK - 30351 s/n 41001.0001;

DI 630 A - 30369 s/n 41001.0001;

DV 620 BK - 29927 s/n 41001.0001;

DV 620 BK UK - 30349 s/n 41001.0001;

DV 620 K IX UK - 30350 s/n 41001.0001;

DV 620 WH - 29928 s/n 41001.0001;

DV 620 WH UK - 30348 s/n 41001.0001;

DV 630 A BR - 30695 s/n 40830.0001;

DV 630 A IX - 30693 s/n 40830.0001;

DV 630 A WH - 30694 s/n 40830.0001;

DV 640 A IX - 30368 s/n 40830.0001;

DV 650 A IX - 30696 s/n 40830.0001;

DV 650 A WH - 30697 s/n 40830.0001;

DV 670 A BR - 30701 s/n 40830.0001;

DV 670 A IX - 30699 s/n 40830.0001;


DV 670 A WH - 30700 s/n 40830.0001;

DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;
FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;
FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;
IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;
IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;
IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;

IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;
IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;
IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;
L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;
L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;
LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;

LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;
LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;
LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;
LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;
LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;
LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;

LVO 670 DUO IX - 30848 s/n 40830.0001;
 LVO 680 DUO IX - 29951 s/n 40902.0001;
 LVR 640 A AN - 33614 s/n 40902.0001;
 LVR 640 A OW - 33615 s/n 40902.0001;
 LVR 670 AN - 33616 s/n 40830.0001;
 LVR 670 OW - 33617 s/n 40830.0001;
 LVTI 12-55 - 29574 s/n 41001.0001;
 LVTI 12-66 - 29575 s/n 41001.0001;
 SDW 60 P - 31010 s/n 40906.0001;
 XLV 670 DUO IX - 29950 s/n 41001.0001.

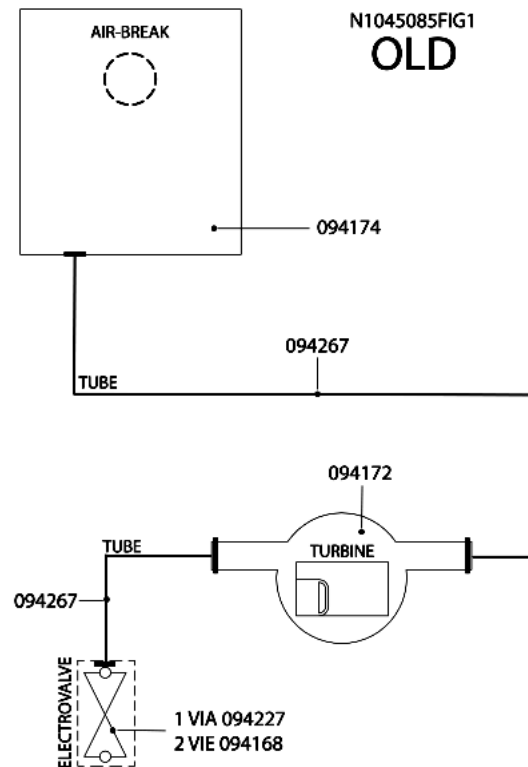

n1045093: Modification of light blue folding shelf attachment.

From serial no. 41109.0001 all models affected by this bulletin feature a modification of the folding shelf to upper basket coupling system.

This modification called for alteration of the relative baskets: the distance between the wire on which the folding shelf is attached and the wire below it has been increased from 9.5 mm to 17 mm, as shown in the attached image.


The altered folding shelves are not interchangeable and cannot be installed on premodification baskets: in the case of service interventions on product with serial number prior to 41109.0001 the entire upper basket must be replaced.

The baskets are reciprocally interchangeable and are managed as assemblies complete with their accessories, inclusive of folding shelves.

The replacement P/Ns affected by the modification are as follows:

UPPER BASKET LIGHT BLUE FOLDING SHELF


new 114799 - premodification 094140.

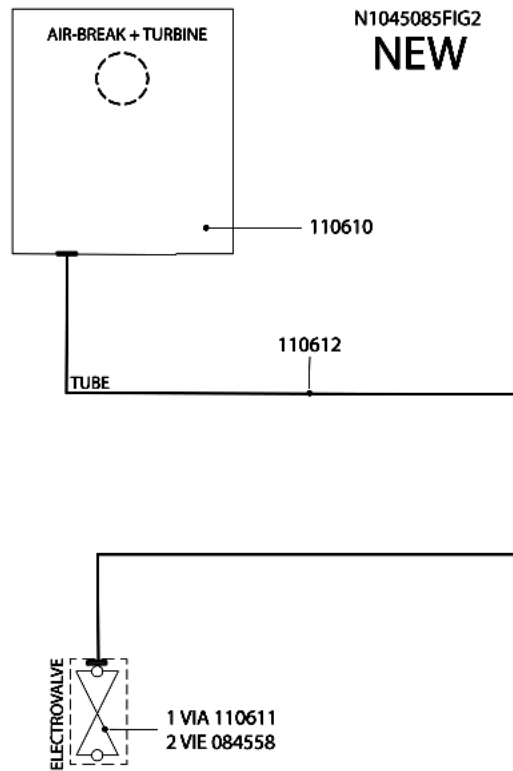

UPPER BASKET ASSEMBLIES

new 115001 - premodification 094139;
 new 115002 - premodification 094222;
 new 115003 - premodification 094233.

N1045093FIG1
NEW FLAP UPPER BASKET SAT CODE 114799

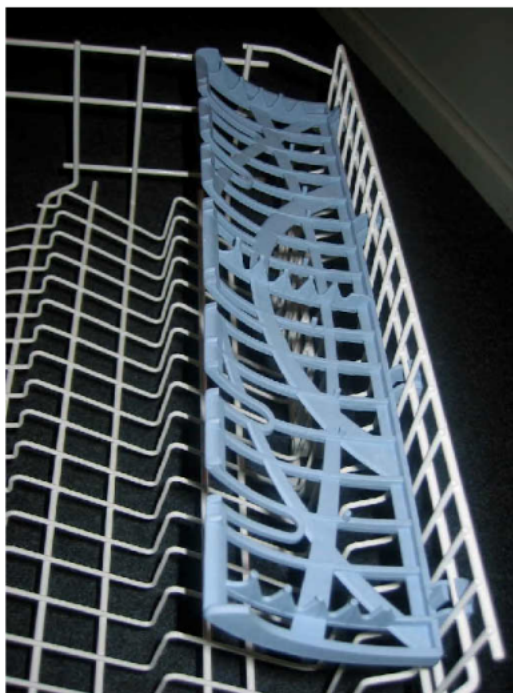

N1045093FIG2
OLD FLAP UPPER BASKET SAT CODE 094140



n1045110: Zmiana usytuowania rozdzielacza elektrycznego

Zmieniono usytuowanie rozdzielacza elektrycznego zgodnie z załączonym rysunkiem.
Nowe urządzenia różnią się od tych sprzed zmiany nowym kodem przemysłowym.

Wprowadzone części:

C00118141 kosz górny

C00108981 drzwiczki wewnętrzne

C00109858 panel dźwiękochłonny wewnętrzny drzwiczek

C00109857 przekładka wewnętrzna drzwiczek

Części sprzed zmiany:

C00115002 kosz górny

C00094695 drzwiczki wewnętrzne

C00094184 panel dźwiękochłonny wewnętrzny drzwiczek

C00094147 przekładka wewnętrzna drzwiczek

Poniżej podano listę produktów o numerach seryjnych z wprowadzoną zmianą.

cc 34381 s/n 50521.0001 LL68FR

N1045076FIG1

Mark II



n1045127: Nowy zawór air-break -rozwiązanie przeciwko chlapaniu wodą od dołu zmywarki 60CM

Od numeru seryjnego 50930.0001, aby rozwiązać problem chlapania wodą w części dolnej prawej i lewej drzwiczek, wprowadzono do produkcji następujące zmiany:

1-Air-break bez przegrody w celu zapewnienia ewentualnego rozładowania ciśnienia

2-Panel górny falisty do ochrony mebli kuchennych przed powstającą parą (tylko w modelach do zabudowy)

3-Uszczelka zbiornika wydłużona o 3cm, aby poprawić szczelność hydrauliczną

4-Panel dźwiękochłonny sklepienia profilowany

5-Trzy sprężynki do prawidłowego mocowania uszczelki drzwiczek na dnie zbiornika (w produkcji od numeru seryjnego 50701.0001)

Nowe części:

C00141308 - Air-break

C00141310 - Panel górny falisty (tylko w modelach do zabudowy)

C00141317 - Uszczelka zbiornika

C00141314 - Panel dźwiękochłonny sklepienia

C00140679 - Sprężyna mocująca uszczelki dno zbiornika

Części przed zmianą

C00110610 - Air-break

C00116110 - Uszczelka zbiornika

C00097300 - Panel dźwiękochłonny sklepienia

1) WYMIANA ZAWORU AIR-BREAK

Należy obowiązkowo stosować nową część; w razie wymiany w produktach sprzed modyfikacji postępować w następujący sposób:

- wymienić air-break na nowy C00141308
- jeśli był, pozostawić panel dźwiękochłonny sklepienia produktu wycinając otwór o przekroju 10x10 cm w tylnym lewym rogu
- przy zabudowie, założyć na górę zmywarki panel górny falisty C00141310
- wymienić uszczelkę zbiornika na nową C00141317

UWAGA: w przypadku wymiany zaworu air-break bez turbiny licznika litrów używać wyłącznie tego samego typu części (kod C00094174 - wszystkie detale są zawarte w notatce n1045085)

2) WYMIANA USZCZELKI ZBIORNIKA

W produktach o numerach seryjnych od 40101.0001 do 50930.0001 można zastosować nową uszczelkę zbiornika C00141317 przycinając ją na obu końcach o 1,5cm.