

# EXPLODED VIEW


## INTRODUCTION INVERTER


### PRO INVERTER


#### MODEL:

| Customer Model | Product Code      | SVC Model     |
|----------------|-------------------|---------------|
| MH6535GDB      | MH6535GDB.CBKQEUF | MH6535GDB /00 |
| MH6535GDH      | MH6535GDH.CWHQEUF | MH6535GDH /00 |
| MH6535GDH      | MH6535GDH.CWHQEUS | MH6535GDH /00 |
| MH6535GDR      | MH6535GDR.CBKQEUF | MH6535GDR /00 |
| MH6535GDS      | MH6535GDS.CBKQEUF | MH6535GDS /00 |
| MH6535GDS      | MH6535GDS.CBKQEUS | MH6535GDS /00 |


| Customer Model | Product Code      | SVC Model     |
|----------------|-------------------|---------------|
| MH6535GDB      | MH6535GDB.CB1QEUF | MH6535GDB /01 |
| MH6535GDH      | MH6535GDH.CW1QEUF | MH6535GDH /01 |
| MH6535GDH      | MH6535GDH.CW1QEUS | MH6535GDH /01 |
| MH6535GDR      | MH6535GDR.CB1QEUF | MH6535GDR /01 |
| MH6535GDS      | MH6535GDS.CB1QEUF | MH6535GDS /01 |
| MH6535GDS      | MH6535GDS.CB1QEUS | MH6535GDS /01 |
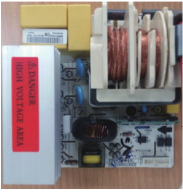
|                   |                                                                                                    |
|-------------------|----------------------------------------------------------------------------------------------------|
|                   | Old (ECN : /00)                                                                                    |
| PCB Assembly, Inv | <br>EBR81604808 |

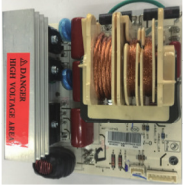
|                   |                                                                                                  |
|-------------------|--------------------------------------------------------------------------------------------------|
|                   | New (ECN : /01)                                                                                  |
| PCB Assembly, Inv | <br>EBR82899202 |

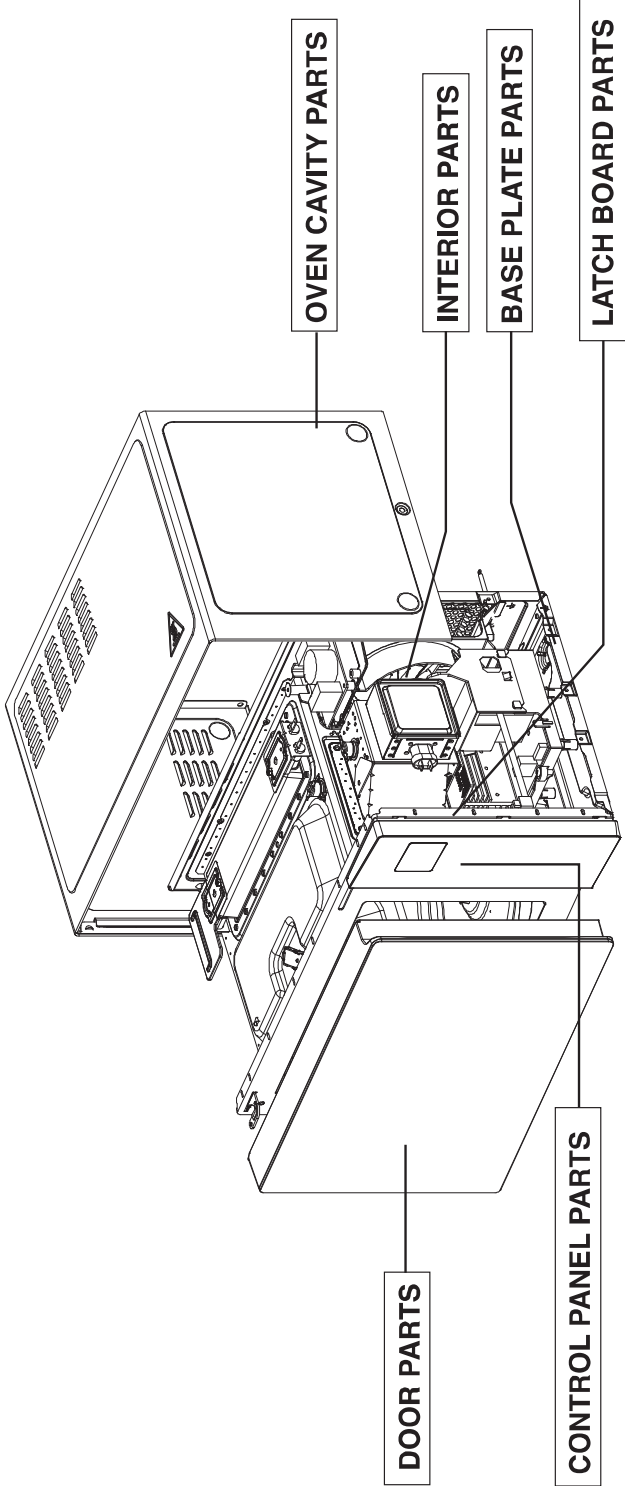

DOOR PARTS

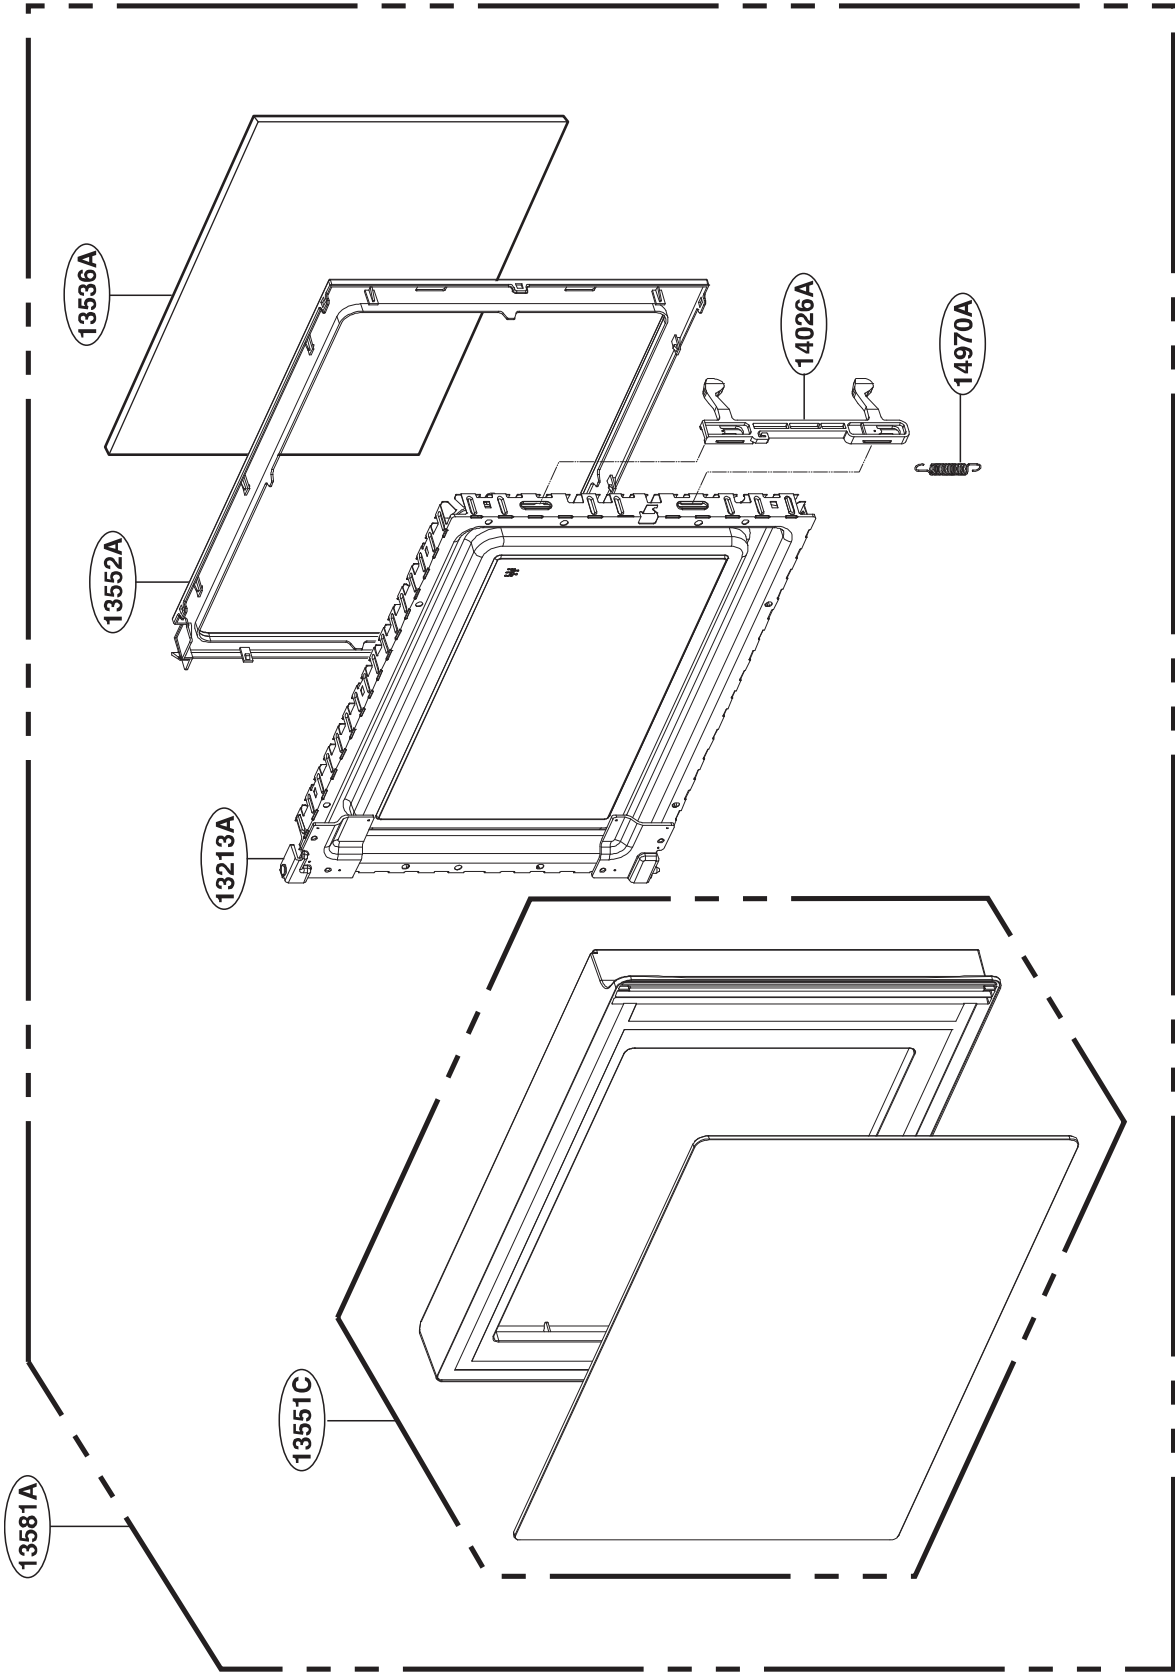


# CONTROL PANEL PARTS

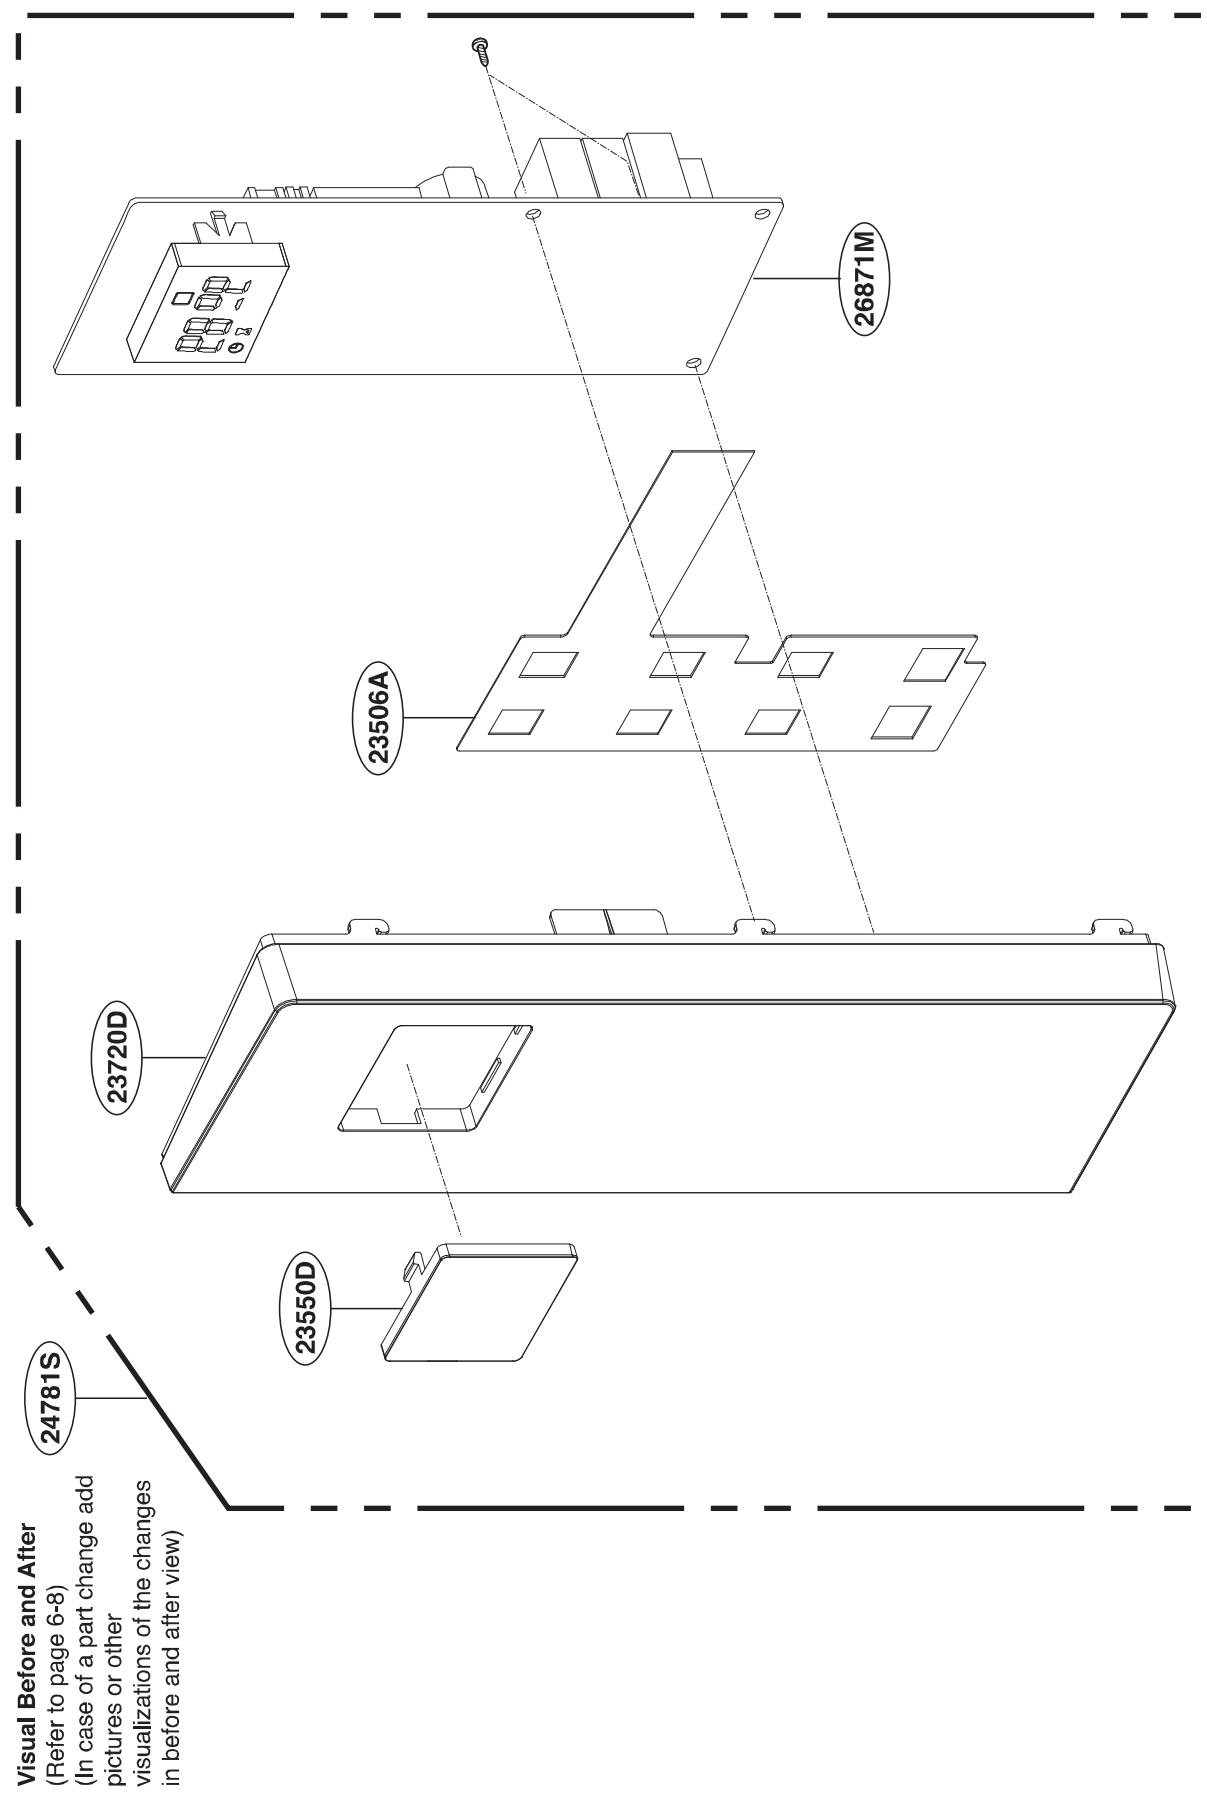

**Visual Before and After**  
(Refer to page 6-8)  
(In case of a part change add  
pictures or other  
visualizations of the changes  
in before and after view)


# OVEN CAVITY PARTS

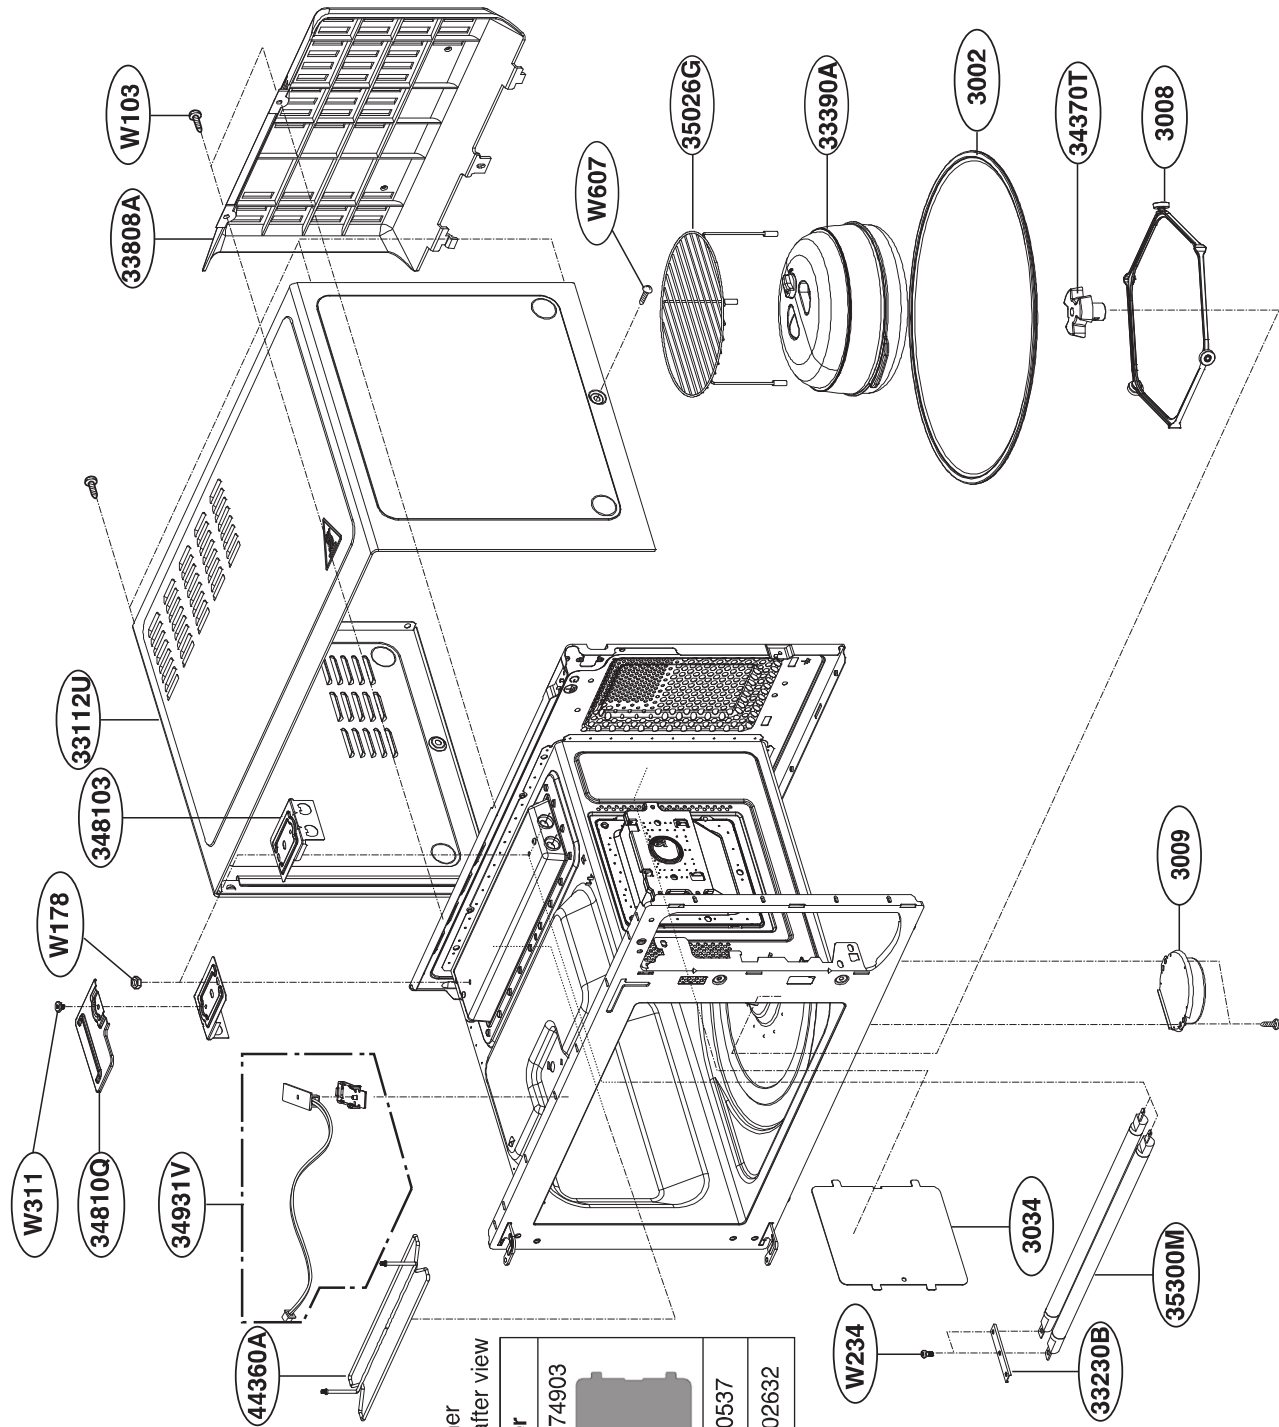



**\* Visual Before and After:**  
(In case of a part change add pictures or other visualizations of the changes in before and after view)

| Part Name        | Before      | After       |
|------------------|-------------|-------------|
| Cover, Insulator | MCK69074902 | MCK69074903 |
| Cavity Assy      | ABU740537   | ABU740537   |
| Screw            | -           | 1TTG0402632 |

# LARCH BOARD PARTS

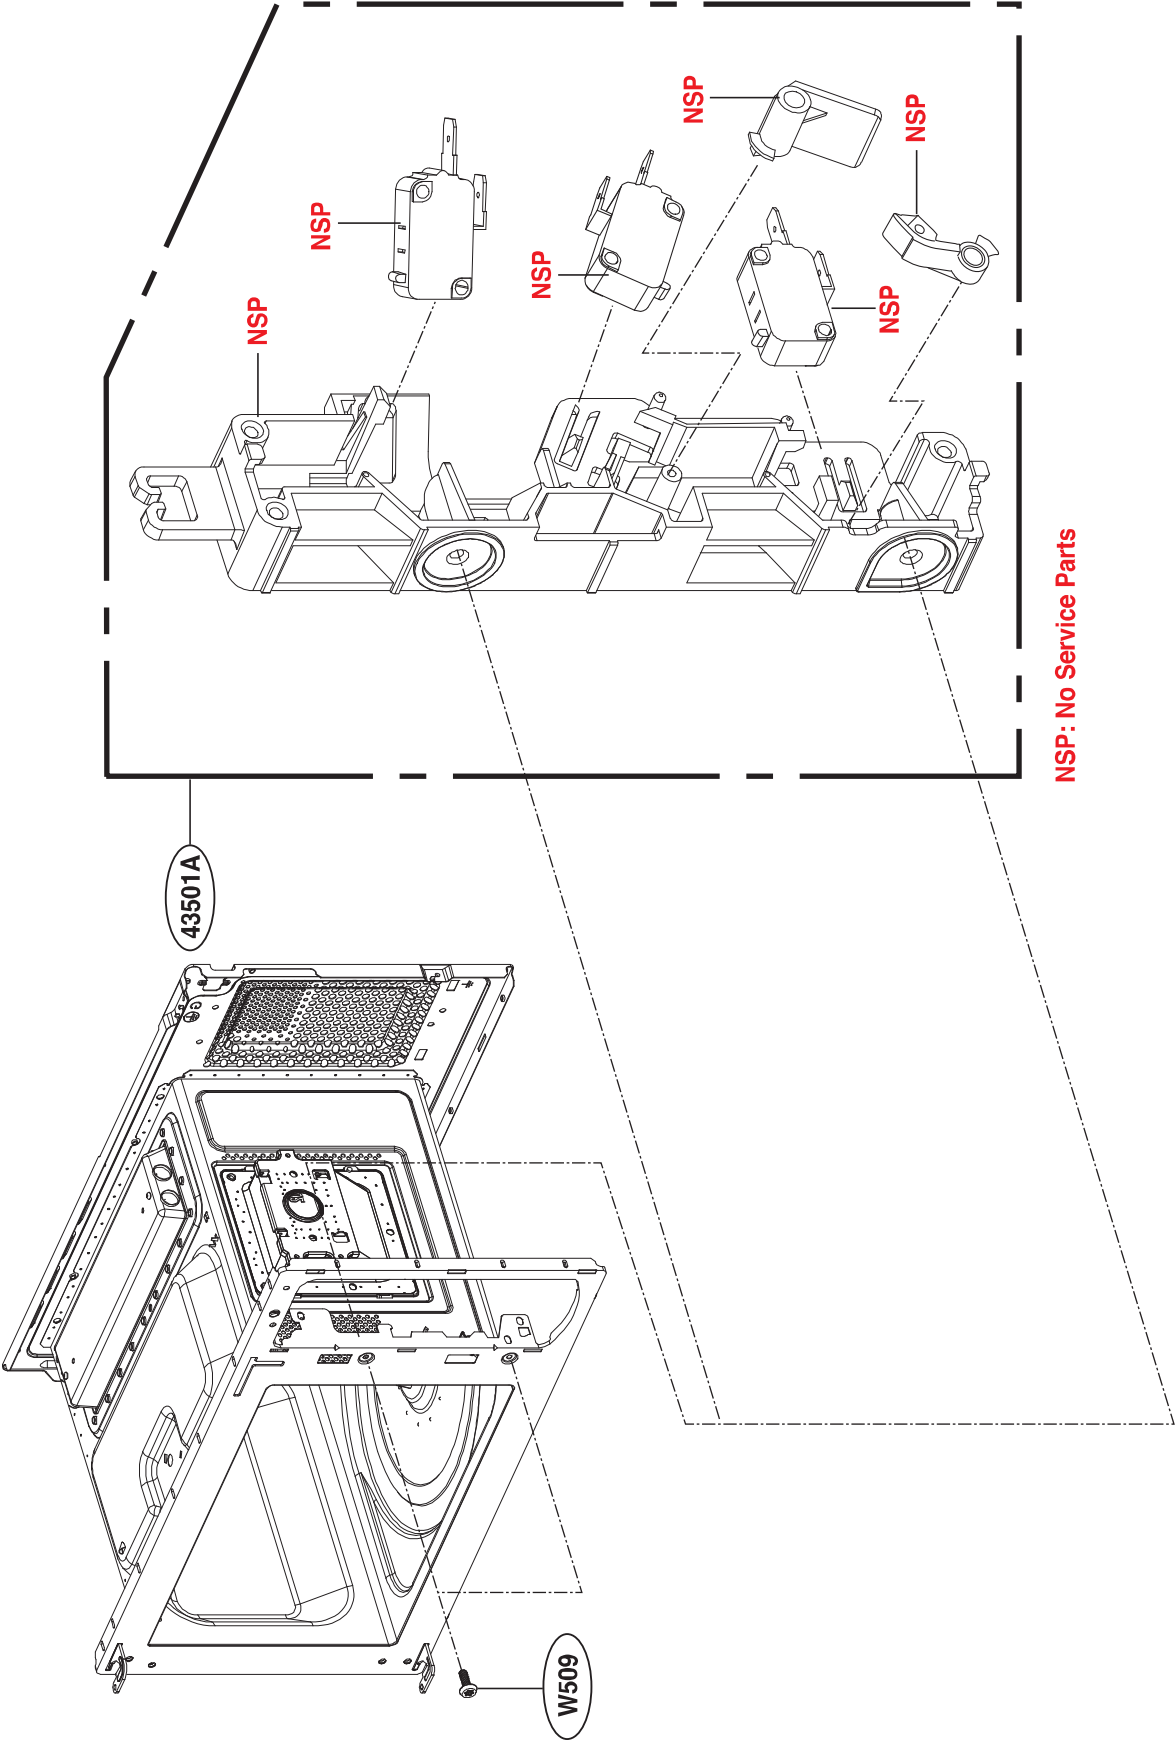


# INTERIOR PARTS

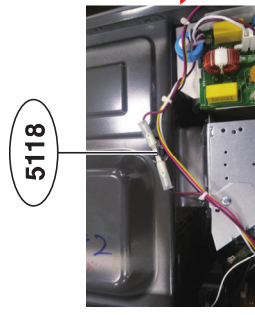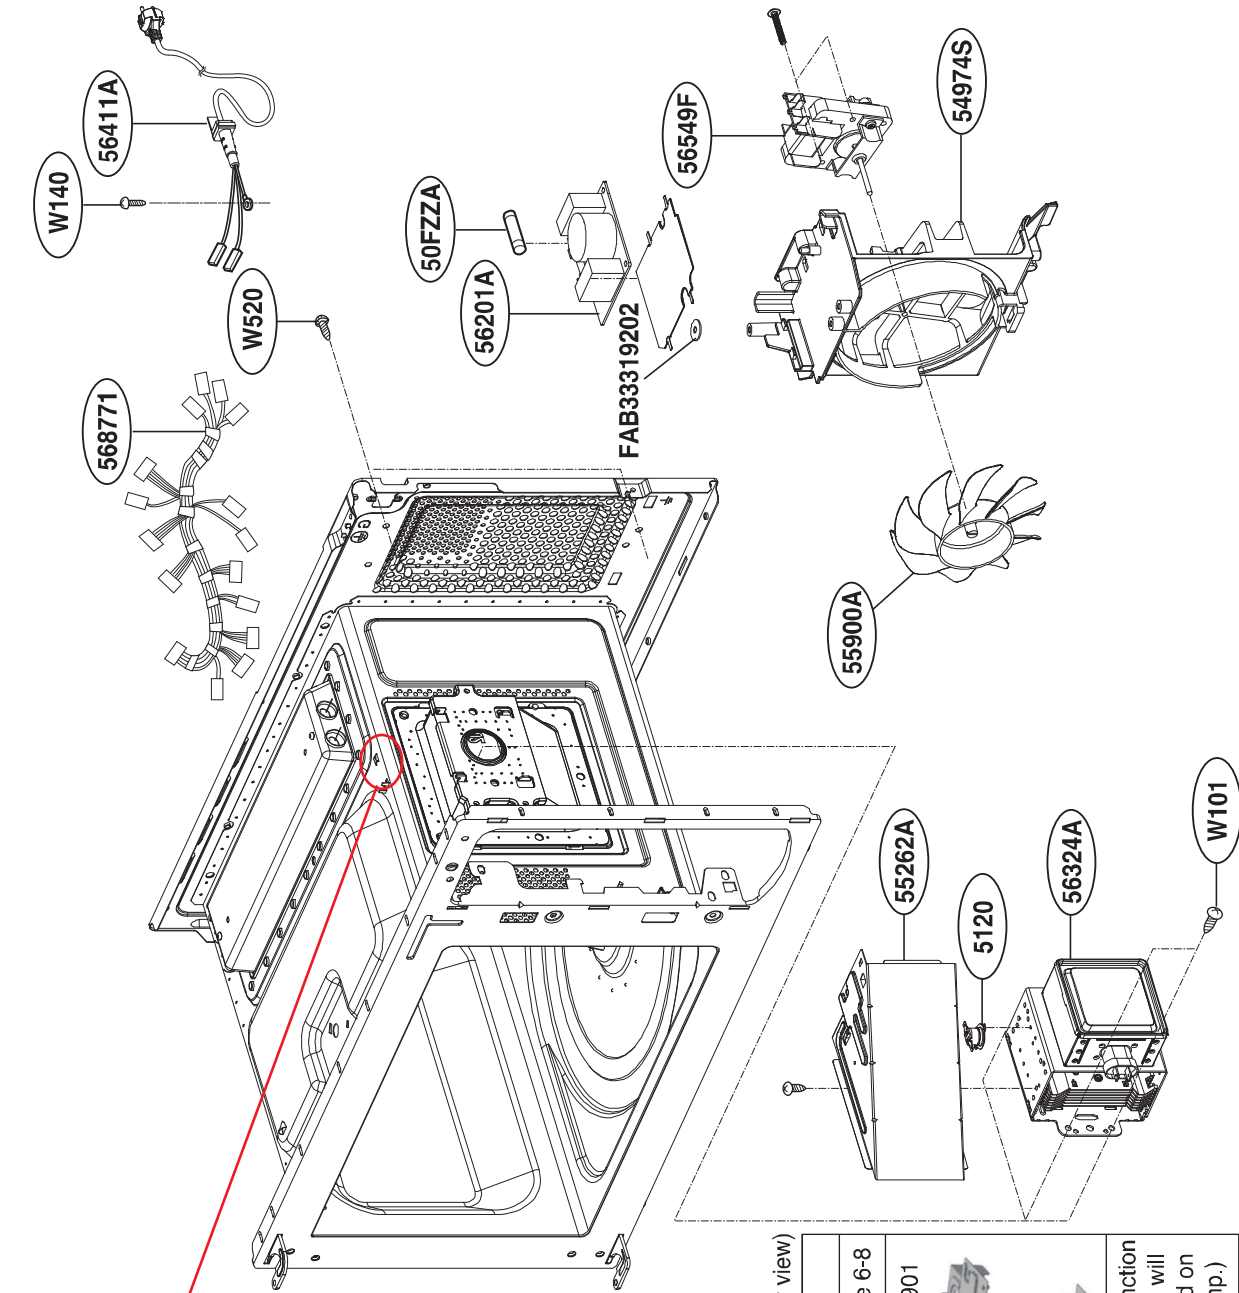

**\* Visual Before and After:**  
(In case of a part change add pictures or other visualizations of the changes in before and after view)

| Part Name     | Before                                                               | After                                                                |
|---------------|----------------------------------------------------------------------|----------------------------------------------------------------------|
| PCB           | Refer to page 6-8                                                    | Refer to page 6-8                                                    |
| Duct          | MCZ64052102<br>                                                      | MCZ64391901<br>                                                      |
| Cooling Logic | After cook finish, Cooling fan will work for one minute obligatorily | Delete the function (Cooling fan will work depend on inverter temp.) |

BASE PLATE PARTS

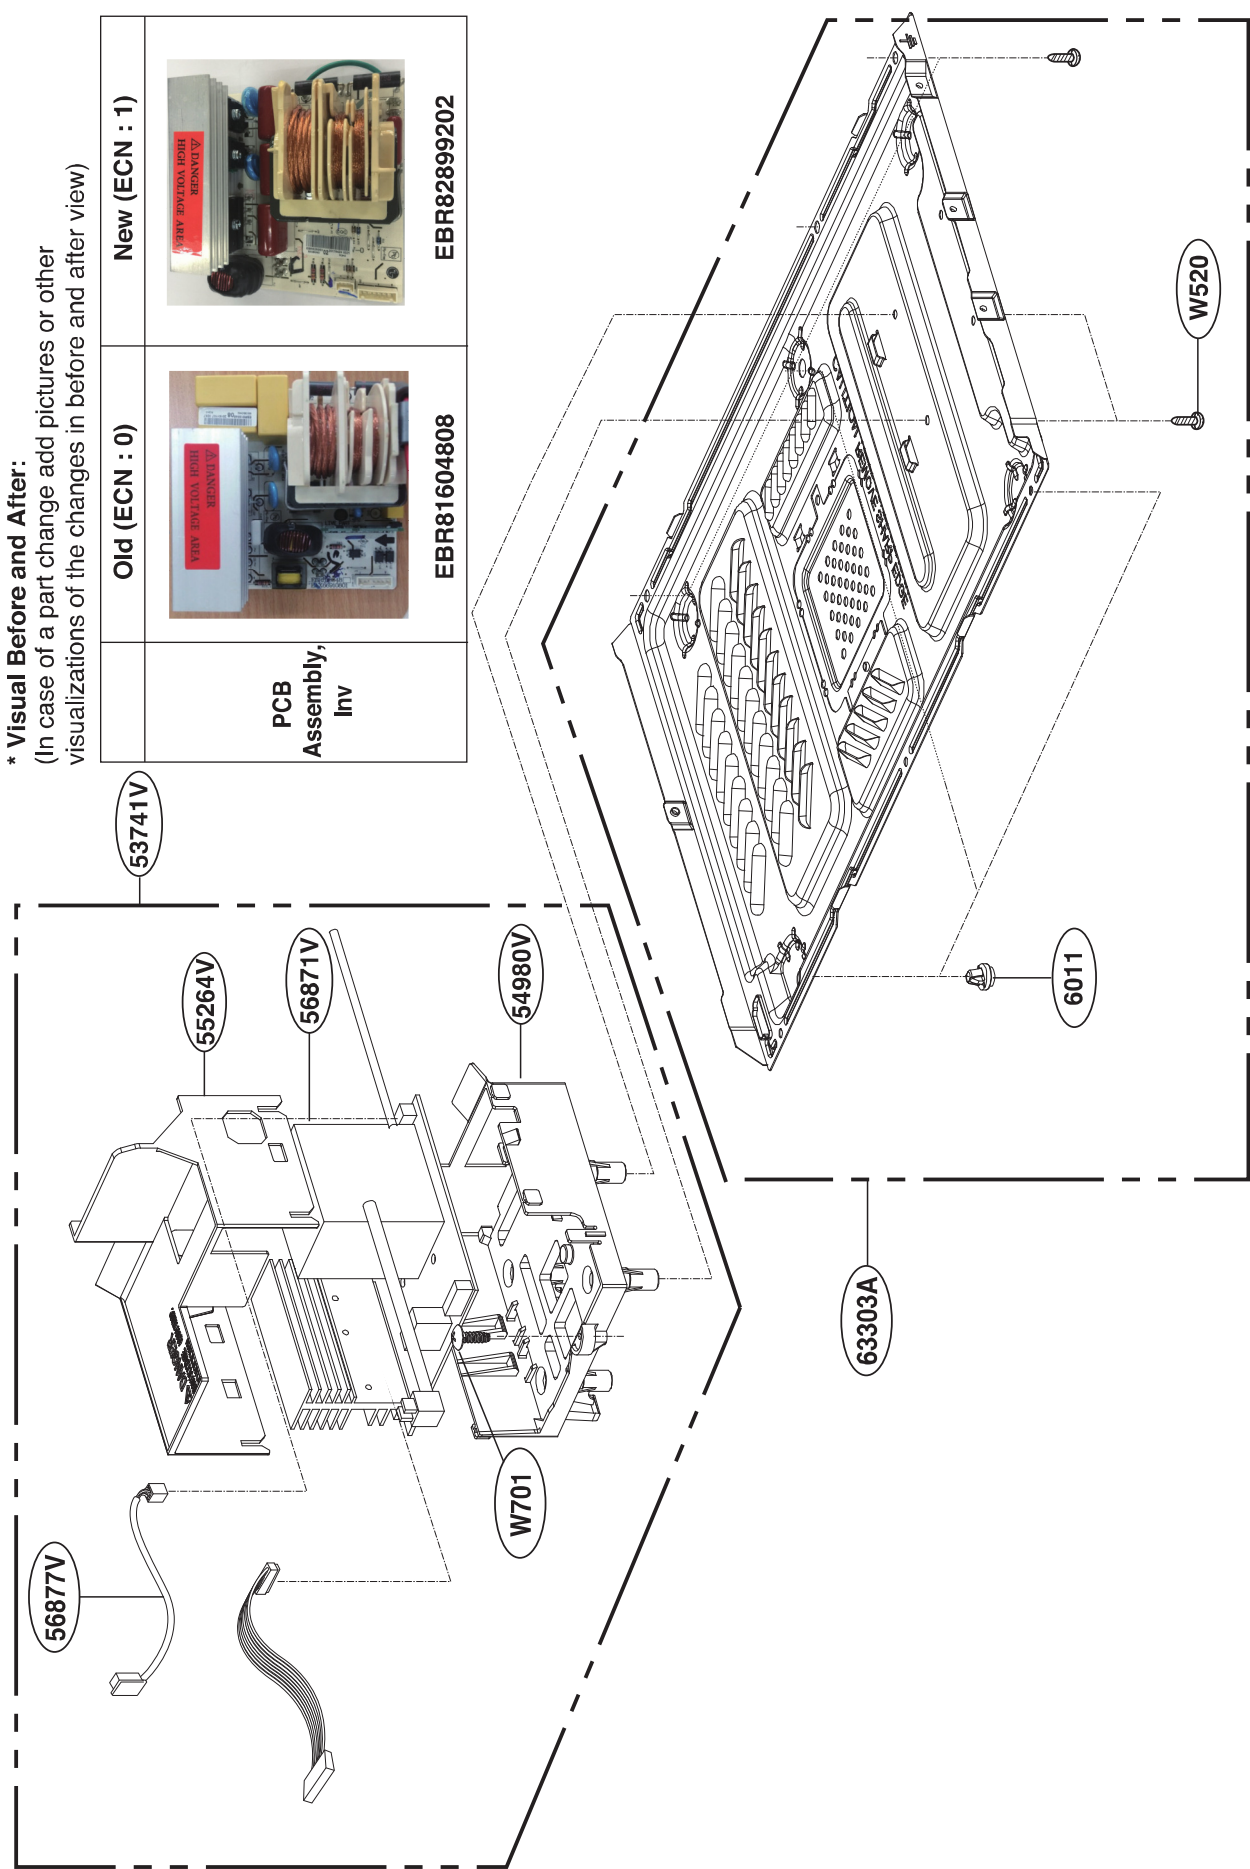

\* Visual Before and After:  
(In case of a part change add pictures or other visualizations of the changes in before and after view)

\* Change model part list :

|     | Model              | PCB Assembly, Main |             | Controller Assembly, Touch / Door Assembly, Full |             | Duct                |                     |
|-----|--------------------|--------------------|-------------|--------------------------------------------------|-------------|---------------------|---------------------|
|     |                    | Before             | After       | Before                                           | After       | Before              | After               |
| CIS | MS2595DIS.BBKQCIS  | EBR80969605        | EBR80969642 | ACM74779304                                      | ACM74779332 | duct<br>MCZ64052102 | duct<br>MCZ64391901 |
|     | MS2595CIS.BSSQCIS  | EBR80969605        | EBR80969642 | ACM74779304                                      | ACM74779332 |                     |                     |
|     | MS2595GIS.BBKQCIS  | EBR81132216        | EBR81132264 | ACM75058707                                      | ACM75058717 |                     |                     |
|     | MS2595GIH.BWHQCIS  | EBR81132216        | EBR81132264 | ACM75058704                                      | ACM75058716 |                     |                     |
|     | MS2535GIS.BBKQCIS  | EBR81132204        | EBR81132265 | ACM74959203                                      | ACM74959255 |                     |                     |
|     | MS2595FISW.BWHQCIS | EBR81816903        | EBR81816905 | ACM74998804                                      | ACM74998806 |                     |                     |
|     | MH6595CIS.BSSQCIS  | EBR80969604        | EBR80969643 | ACM74779307                                      | ACM74779333 |                     |                     |
|     | MH6595GIH.BWHQCIS  | EBR81132205        | EBR81132266 | ACM75058705                                      | ACM75058714 |                     |                     |
|     | MH6565CIR.BSSQCIS  | EBR81500905        | EBR81500919 | ADC75486202                                      | ADC75486209 |                     |                     |
|     | MH6565DIS.BBKQCIS  | EBR81500905        | EBR81500919 | ADC75645801                                      | ADC75645812 |                     |                     |
|     | MS2535GDH.BWHQEUF  | EBR81132206        | EBR81132258 | ACM74959207                                      | ACM74959261 |                     |                     |
|     | MS2535GDS.BBKQEUF  | EBR81132206        | EBR81132258 | ACM74959205                                      | ACM74959260 |                     |                     |
|     | MS2535GDB.BBKQEUF  | EBR81132206        | EBR81132258 | ACM74959205                                      | ACM74959260 |                     |                     |
|     | MH6535GDS.BBKQEUF  | EBR81132207        | EBR81132259 | ACM74959204                                      | ACM74959259 |                     |                     |
| FS  | MH6535GDH.BWHQEUF  | EBR81132207        | EBR81132259 | ACM74959208                                      | ACM74959262 | duct<br>MCZ64052102 | duct<br>MCZ64391901 |
|     | MH6535GDB.BBKQEUF  | EBR81132207        | EBR81132259 | ACM74959204                                      | ACM74959259 |                     |                     |
|     | MH6535GDR.BBKQEUF  | EBR81132207        | EBR81132259 | ACM74959204                                      | ACM74959259 |                     |                     |
|     | MS2595CIS.BSSQEUD  | EBR80969613        | EBR80969639 | ACM74779310                                      | ACM74779335 |                     |                     |
|     | MH6535GIS.BBKQEUD  | EBR81132221        | EBR81132261 | ACM74959214                                      | ACM74959264 |                     |                     |
|     | MH6535GIH.BWHQEUD  | EBR81132221        | EBR81132261 | ACM74959213                                      | ACM74959263 |                     |                     |
|     | MH6565CPS.BSSQEUD  | EBR81500908        | EBR81500918 | ADC75486206                                      | ADC75486211 |                     |                     |
|     | MH6535GDH.BWHQEUS  | EBR81132207        | EBR81132258 | ACM74959208                                      | ACM74959262 |                     |                     |
|     | MH6535GDS.BBKQEUS  | EBR81132207        | EBR81132258 | ACM74959204                                      | ACM74959259 |                     |                     |
|     | MH6595DPS.BBKQEUS  | EBR80969612        | EBR80969640 | ACM74779309                                      | ACM74779334 |                     |                     |
| EU  | MH6535GPH.BWHQEUS  | EBR81132222        | EBR81132262 | ACM74959215                                      | ACM74959265 | duct<br>MCZ64052102 | duct<br>MCZ64391901 |
|     | MH6535GPS.BBKQEUS  | EBR81132222        | EBR81132262 | ACM74959216                                      | ACM74959266 |                     |                     |
|     | MS2536DB.BBK7LAP   | EBR81132201        | EBR81132263 | ACM74959201                                      | ACM74959269 |                     |                     |
|     | MS2596OW.BWH7LAP   | EBR80969603        | EBR80969641 | ACM74779303                                      | ACM74779336 |                     |                     |
|     | MS2596OS.BSS7LAP   | EBR80969603        | EBR80969641 | ACM74779303                                      | ACM74779336 |                     |                     |
|     | MS2596OB.BBK7LAP   | EBR80969603        | EBR80969641 | ACM74779303                                      | ACM74779336 |                     |                     |
| AP  | MS2536DW.BWH7LAP   | EBR81132201        | EBR81132263 | ACM74959210                                      | ACM74959270 |                     |                     |